

# VERSABUILT ROBOTICS



## Mill Automation System Machinist Manual

# Table of Contents

<a href="#"><u>Section 1</u></a>	<a href="#"><u>Safety Warnings</u></a>
<a href="#"><u>Section 2</u></a>	<a href="#"><u>Selecting Automatic vs Manual Mode</u></a>
<a href="#"><u>Section 3</u></a>	<a href="#"><u>Introduction to MultiGrip Jaws</u></a>
<a href="#"><u>Section 4</u></a>	<a href="#"><u>MultiGrip Jaw Design and Machining</u></a>
<a href="#"><u>Section 5</u></a>	<a href="#"><u>Preparing to Automate a New Part</u></a>
<a href="#"><u>Section 6</u></a>	<a href="#"><u>Creating Jaw and Part Configurations</u></a>
<a href="#"><u>Section 7</u></a>	<a href="#"><u>Fundamentals of Successful Automation</u></a>
<a href="#"><u>Appendix A</u></a>	<a href="#"><u>New Part Configuration Worksheet</u></a>
<a href="#"><u>Appendix B</u></a>	<a href="#"><u>Bin Drop Option</u></a>
<a href="#"><u>Appendix C</u></a>	<a href="#"><u>CNC Vise Control</u></a>

# Safety Warnings

**DANGER:** VersaBuilt makes industrial machine tool automation components designed to be operated by trained personnel only. Machine tool automation components may move suddenly and without warning. Serious or fatal crushing injuries can occur from contact with the robot, gripper or vises.

Before deploying VersaBuilt industrial machine tool automation components, a safety risk assessment must be completed in accordance with local, state and/or federal requirements.

VersaBuilt industrial machine tool automation components should only be used by trained operators.

**Read and understand the VersaBuilt Mill Automation System Safety Manual before proceeding**

# Selecting Automatic vs Manual Mode

## Section 2



# Selecting Automatic vs Manual Mode


The Mill Automation System has 2 pneumatic modes: Auto and Manual

- Auto-Mode is for running parts in the CNC with robotic tending
- Manual-Mode is for running parts in the CNC via hand loading

When the system is in Auto-Mode, air to the hand valves on the CNC table is blocked.

When the system is in Manual-Mode, air to the VSC is blocked, disabling automatic functionality.

Switching between these 2 modes is done by way of the Diverter Valve.

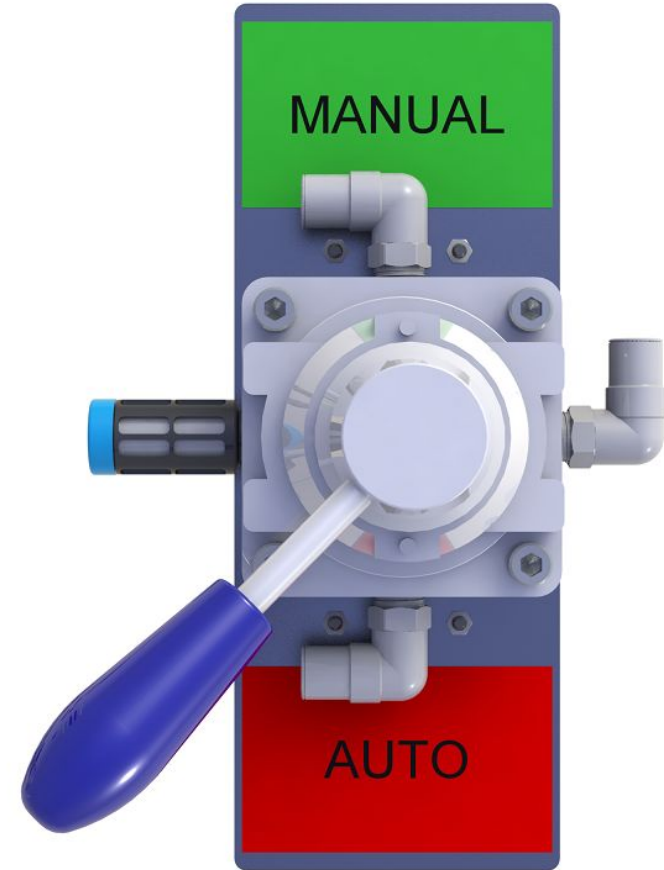


Diverter Valve shown in “Auto-Mode”


# Selecting Pneumatic Automatic vs Manual Mode

## Setting Auto-Mode:

1. Be prepared for sudden movement and keep all body parts away from the pneumatic equipment (vises, gripper, door opener, VersaBlast) when moving the Diverter Valve switch
2. Set each Vise Hand Valve to the center position
3. Ensure all persons are clear of the vises, gripper, door opener and VersaBlast
4. Move the Diverter Valve handle to the AUTO position
5. From the VSC Recovery panel, verify the vises are opening and closing correctly

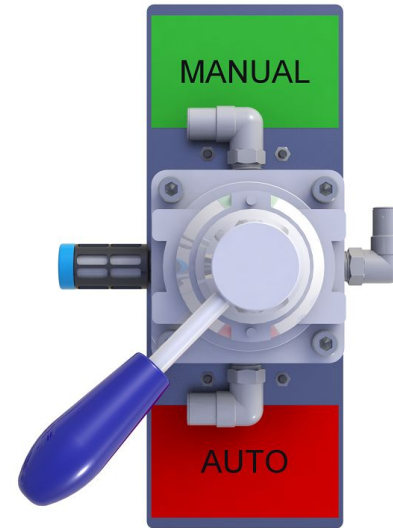

Diverter Valve shown in "Auto-Mode"

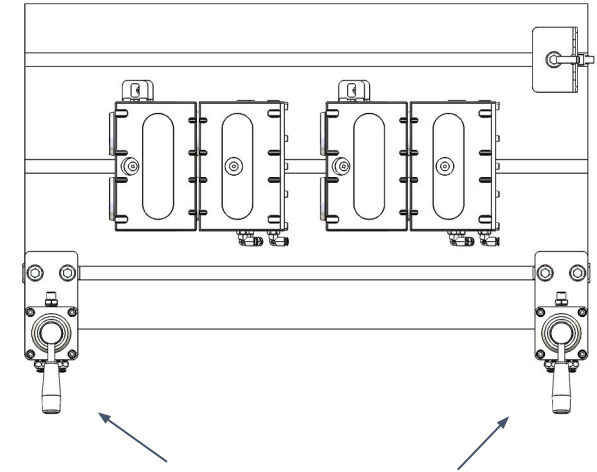


Vise Hand Valves shown in center position

# Selecting Pneumatic Automatic vs Manual Mode

## Setting Manual-Mode:

1. Be prepared for sudden movement and keep all body parts away from the pneumatic equipment (vises, gripper, door opener, VersaBlast) when moving the Diverter Valve switch
2. From the VSC Recovery panel, press the Float Vises button
3. Move the Diverter Valve handle to the MANUAL position
4. With ALL body parts clear of each vise, set each Vise Hand Valve away from the center position to open or close the vises.

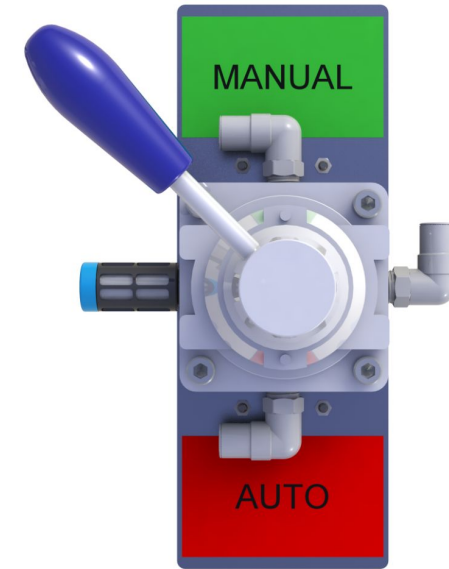

Diverter Valve shown in “Manual-Mode”

**Note:** When MultiGrip OD Jaws are in the Robot Gripper and the diverter valve is shifted to Manual position, the Jaws will SPRING OPEN releasing any clamped material

# Introduction to MultiGrip Jaws

## Section 3


# MultiGrip Introduction

MultiGrip Jaws consist of left and right 6061-T6 aluminum jaws with mating features for clamping parts, engaging a vise and interfacing with a robot gripper.


MultiGrip Jaws are available in OD (outside diameter) and ID (inside diameter) clamping.

The following page includes a summary of the MultiGrip Jaw offerings available, followed by principles for use.

MultiGrip  
Top Jaws

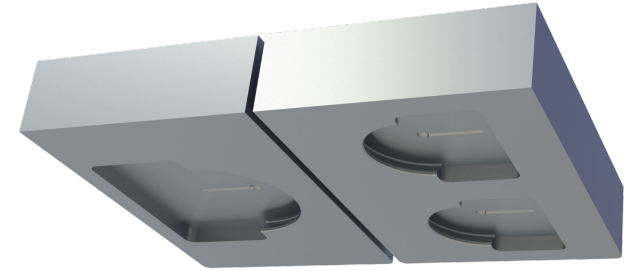

MultiGrip  
Base Jaws

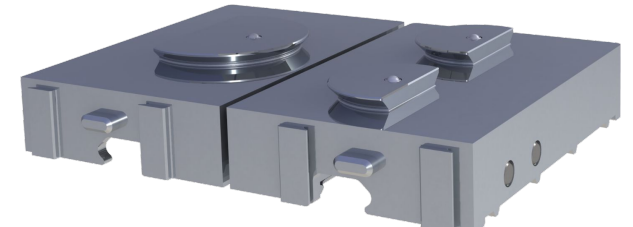

MultiGrip  
Vise



# MultiGrip Product Summary

## MultiGrip Vises

- MultiGrip Vise 4000 (P/N 5010289) - Fixed Jaw Vise with 4240 lbs clamping force at 120 psi
- MultiGrip Vise 4000 w/ Steel Top (P/N 5011287) - Fixed Jaw Vise with 4240 lbs clamping force at 120 psi
- MultiGrip Vise 2000 (P/N 5009518) - Fixed Jaw Vise with 2240 lbs clamping force at 120 psi

## MultiGrip OD Base Jaws

- MultiGrip Base Jaws, OD (P/N 5010220) - Base Jaws used with exchangeable Top Jaws (Swivel-Fixed)
- MultiGrip Base Jaws, OD (Fixed-Fixed) (P/N 5010398) - Base Jaws used with exchangeable Top Jaws (Fixed-Fixed)
- MultiGrip Jaws, OD, 1.5" H (P/N 5010221) - OD Fixed Jaws, 1.5" height
- MultiGrip Jaws, OD, 2.5" H (P/N 5010222) - OD Fixed Jaws, 2.5" height

# MultiGrip Product Summary

## MultiGrip OD Top Jaws

### Swivel-Fixed Top Jaws:

- MultiGrip Top Jaw Set, 1.0" H (P/N 5006796) - 1.0" Exchangeable Top Jaws for OD Base Jaws (Swivel-Fixed)
- MultiGrip Top Jaw Set, 1.5" H (P/N 5002752) - 1.5" Exchangeable Top Jaws for OD Base Jaws (Swivel-Fixed)
- MultiGrip Top Jaw Set, 2.0" H (P/N 5006795) - 2.0" Exchangeable Top Jaws for OD Base Jaws (Swivel-Fixed)
- MultiGrip Top Jaw Set, 3.0" H (P/N 5009389) - 3.0" Exchangeable Top Jaws for OD Base Jaws (Swivel-Fixed)
- MultiGrip Top Jaw Set, Oversized, 1.5" H (P/N 5007394) - 1.5" Top Jaws 2" longer and 2" wider (Swivel-Fixed)

### Fixed-Fixed Top Jaws:

- MultiGrip Top Jaw Set, 1.0" H (P/N 5010399) - 1.0" Exchangeable Top Jaws for OD Base Jaws (Fixed-Fixed)
- MultiGrip Top Jaw Set, 1.5" H (P/N 5010400) - 1.5" Exchangeable Top Jaws for OD Base Jaws (Fixed-Fixed)
- MultiGrip Top Jaw Set, 2.0" H (P/N 5010401) - 2.0" Exchangeable Top Jaws for OD Base Jaws (Fixed-Fixed)
- MultiGrip Top Jaw Set, 3.0" H (P/N 5010402) - 3.0" Exchangeable Top Jaws for OD Base Jaws (Fixed-Fixed)

# MultiGrip Product Summary

## MultiGrip ID Jaws

- MultiGrip Jaws, ID, 1.5" H (P/N 5007344) - ID Fixed Jaws, 1.5" height
- MultiGrip Jaws, ID, 2.5" H (P/N 5005782) - ID Fixed Jaws, 2.5" height
- MultiGrip Jaw ID Setup Fixture (P/N 5007434) - Fixture used when machining ID jaw pockets

## MultiGrip Pallet

- MultiGrip Pallet Base Jaws (P/N 5010770) - MultiGrip Base Jaws with features for picking MultiGrip Pallets
- MultiGrip Pallet, 6 x 8" (P/N 5010127) - Pallet with features on bottom side to be picked by MultiGrip Pallet Base Jaws



# MultiGrip Product Summary

## Universal Jaw Products

- Universal Top Jaws (P/N 5007070) - Hard Anodized Top Jaw set mating with OD Base Jaws
- VersaBites, 3/16" (P/N 5009679) - Hardened Steel with 3/16" z-depth, mating with Universal Top Jaws
- VersaBites, 1/8" (P/N 5009847) - Hardened Steel with 1/8" z-depth, mating with Universal Top Jaws
- Machinable VersaRails (P/N 5009630) - 6061-T6 Aluminum workholding, mating with Universal Top Jaws

## SingleGrip OD Jaws

- SingleGrip Jaws, OD, 1.0" H (P/N 5010309) - OD Jaws for Hand Load or Robot Part Load, 1.0" Height
- SingleGrip Jaws, OD, 1.5" H (P/N 5010310) - OD Jaws for Hand Load or Robot Part Load, 1.5" Height
- SingleGrip Jaws, OD, 2.5" H (P/N 5010311) - OD Jaws for Hand Load or Robot Part Load, 2.0" Height

# Standard MultiGrip Jaw Dimensions


Standard MultiGrip Jaws have a combined surface area of 6" x 8" with available z-depth that varies upon the selected jaw type (fixed jaws or base jaw with top jaws).

Top Jaws can be machined down with 0.375" remaining.

- 0.625" available pocket for 1.0" top jaws
- 1.125" available pocket for 1.5" top jaws
- 1.625" available pocket for 2.0" top jaws

Fixed Jaws can be machined down to 1.125" height


- 0.375" available pocket depth for 1.5" fixed jaws
- 1.375" available pocket depth for 2.5" fixed jaws

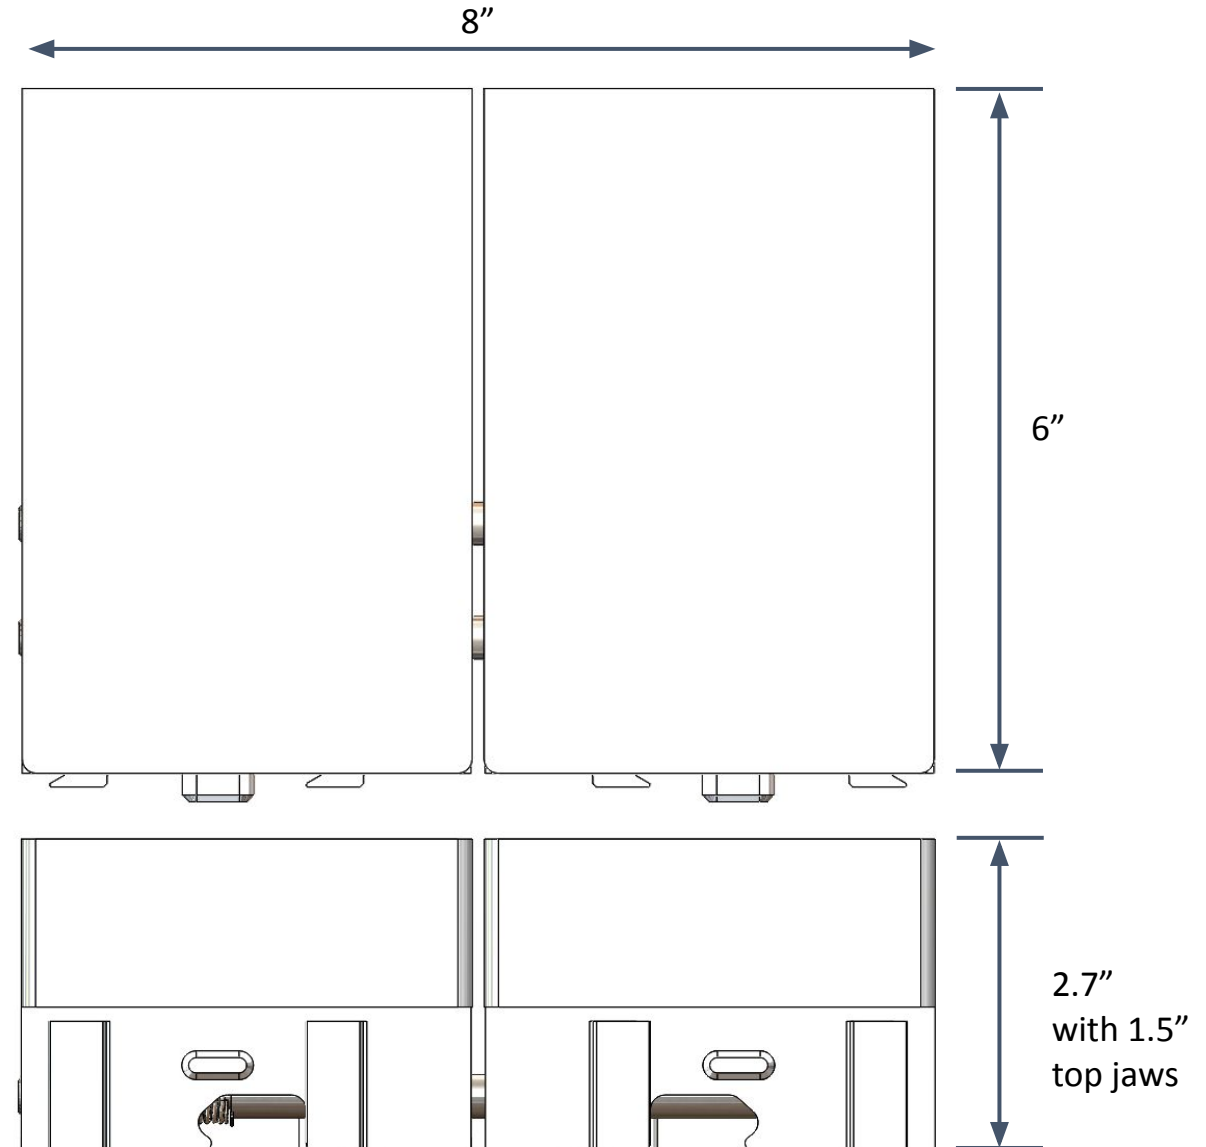

# Oversized MultiGrip Jaw Dimensions

Oversized Top Jaws are available with dimensions shown on the right, giving 8 x 10" of machinable area.

**Note:** custom jaw sizes or interfaces can be bolted onto fixed jaws or top jaws for geometries outside of those shown in this manual. For example: hardened steel or 3D printed interfaces can be fastened to jaws.

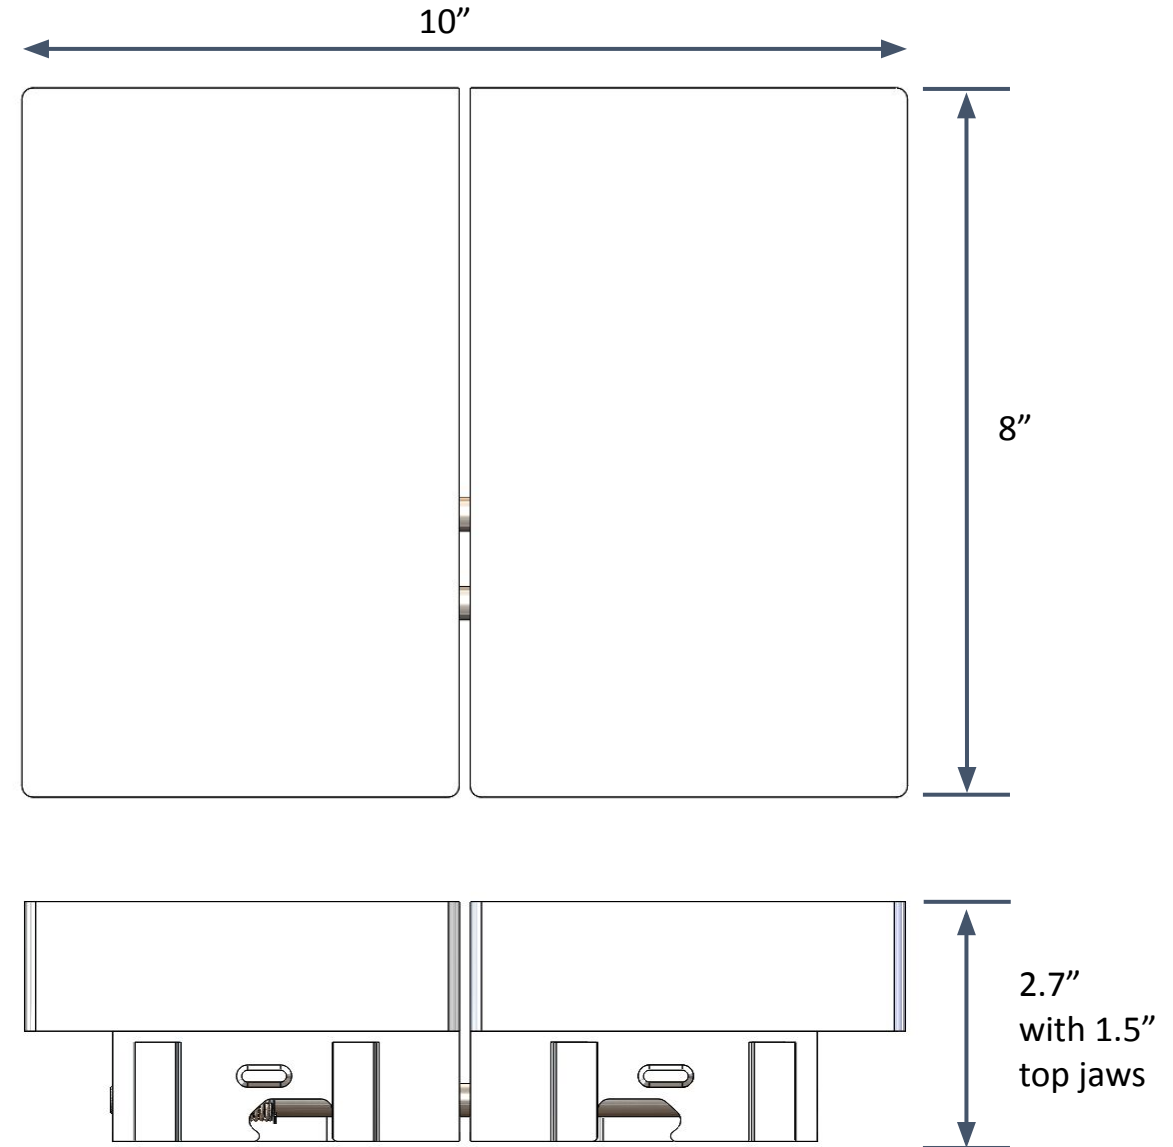



# MultiGrip Jaw Details

Three interfaces to MultiGrip Jaws:

- MultiGrip Vise Interface

- Machinable Part Interface


- Gripper Interface

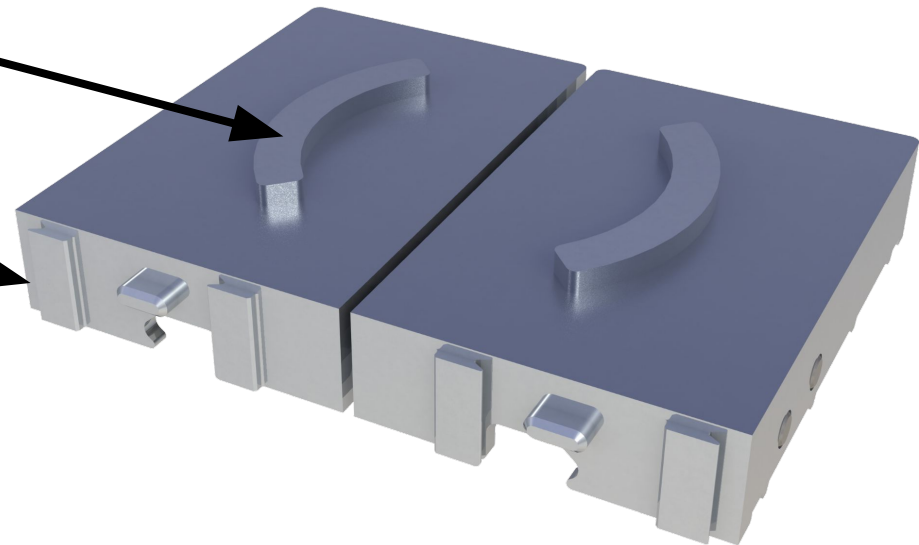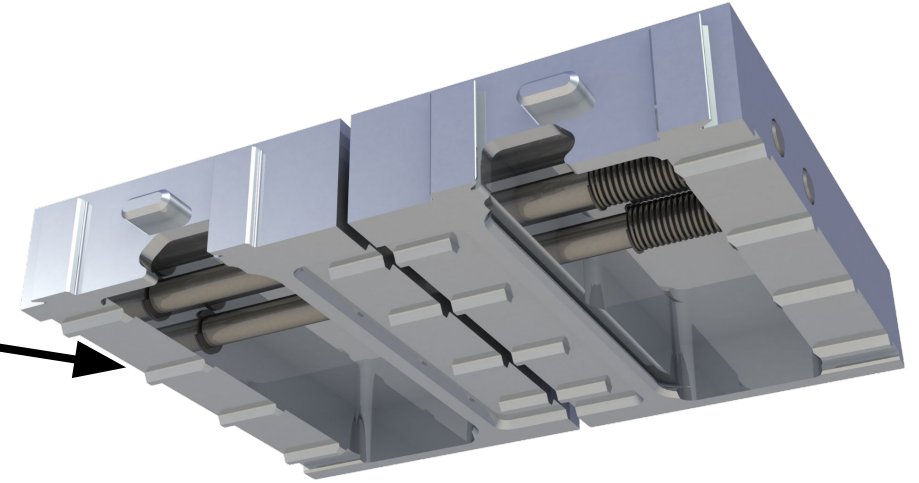

Solid Models are available at  
[www.versabuilt.com](http://www.versabuilt.com) or by contacting  
VersaBuilt via [sales@versabuilt.com](mailto:sales@versabuilt.com)


# MultiGrip Axis Nomenclature

XYZ axis aligned with typical CNC axis

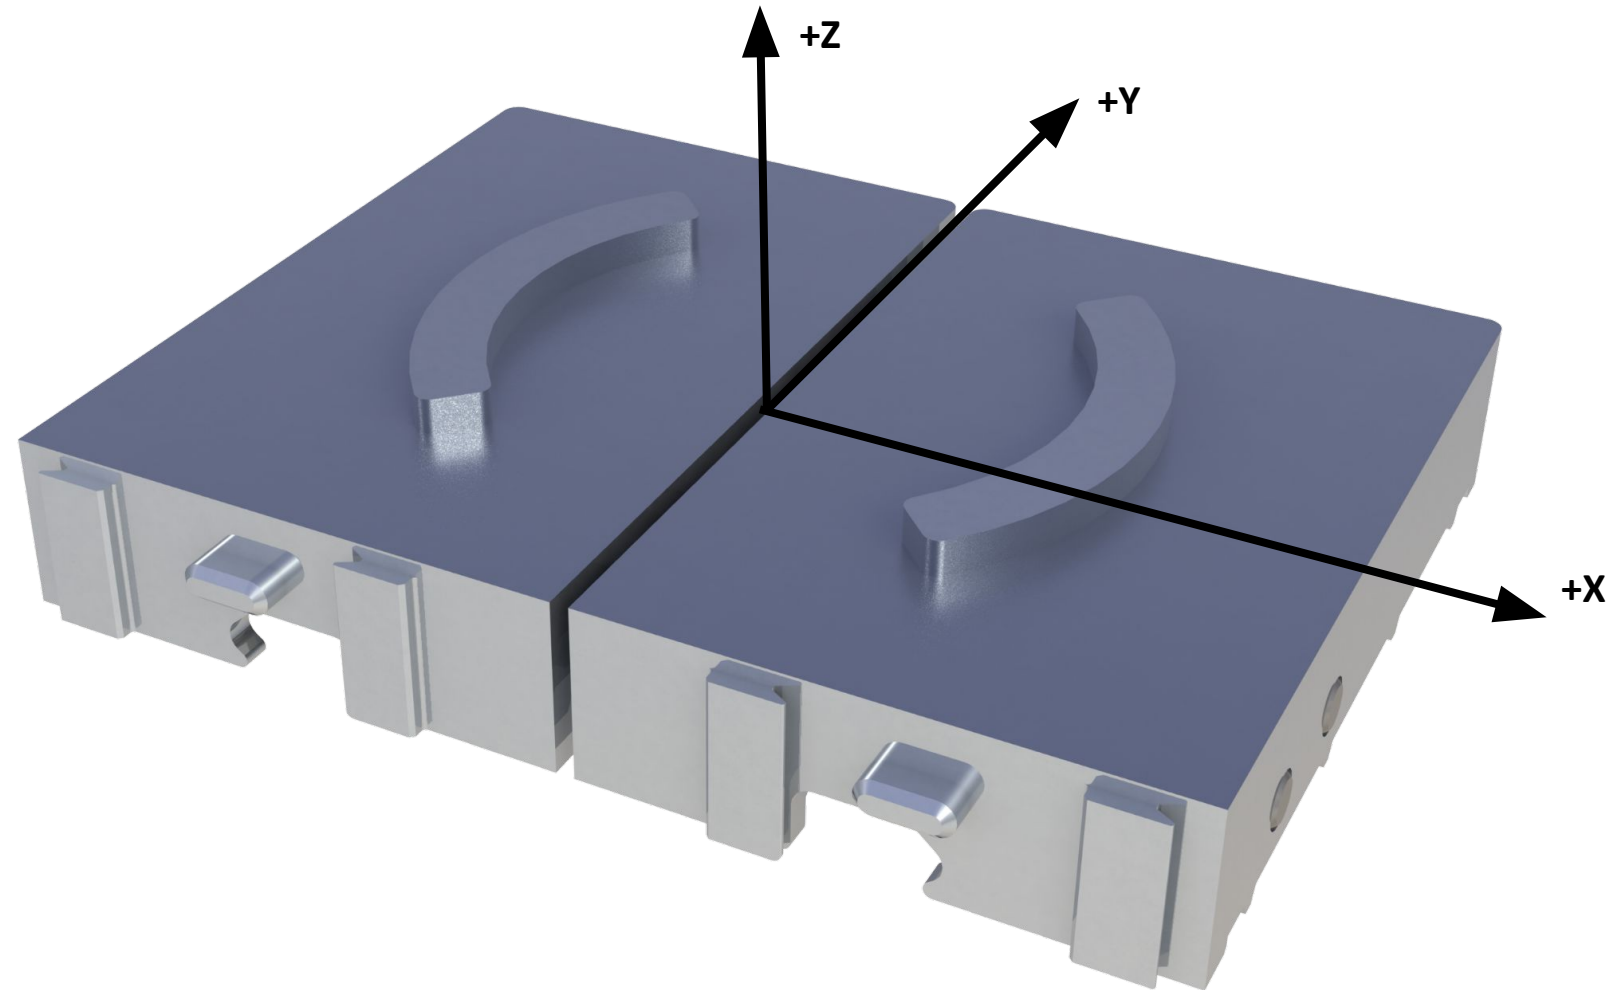


# MultiGrip Jaw Types

## MultiGrip Base Jaws

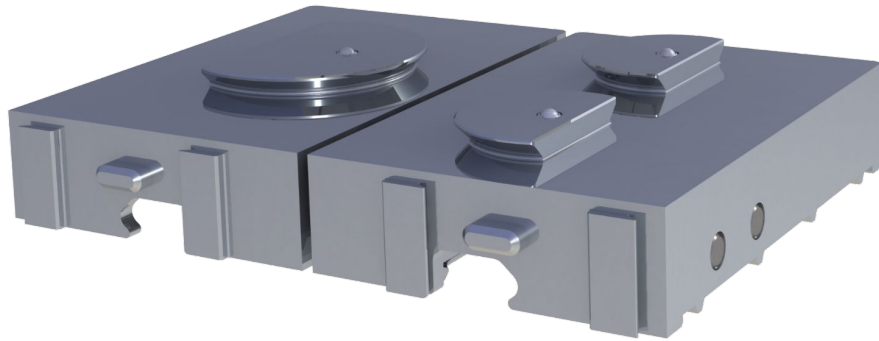


6061-T6 Base Jaws with robot and vise interface, plus Top Jaw interface for quick exchange of Top Jaws (for OD clamping only). Available in swivel-fixed (shown) or fixed-fixed combinations.

## MultiGrip Top Jaws

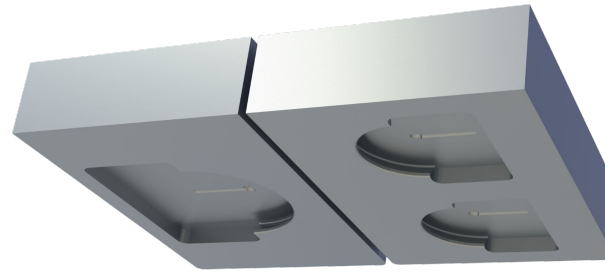

6061-T6 Top Jaws available in multiple thicknesses (1.0, 1.5, 2.5 & 3.0") for machining custom part interface (jaw pockets). Used with MultiGrip Base Jaws. Available in swivel-fixed (shown) or fixed-fixed combinations.


## MultiGrip Fixed Jaws

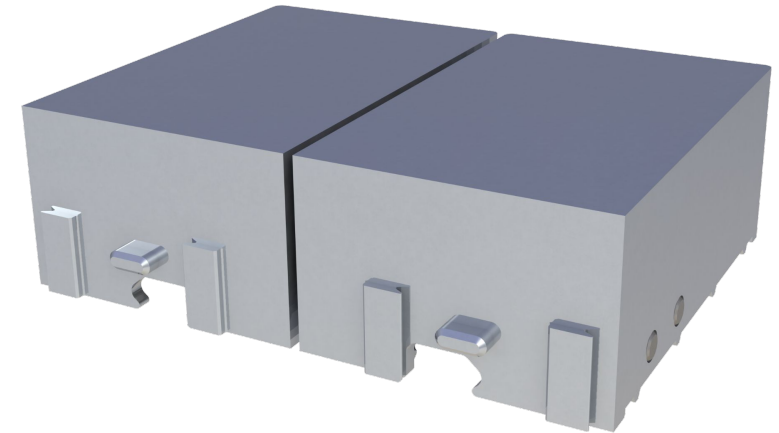


6061-T6 Jaws with robot and vise interface, plus material for machining custom part interface (jaw pockets). Available in for OD and ID Clamping in 1.5" and 2.5" heights.

# MultiGrip Jaw Types

MultiGrip Base Jaws & Universal Top Jaws  
w/ VersaBites

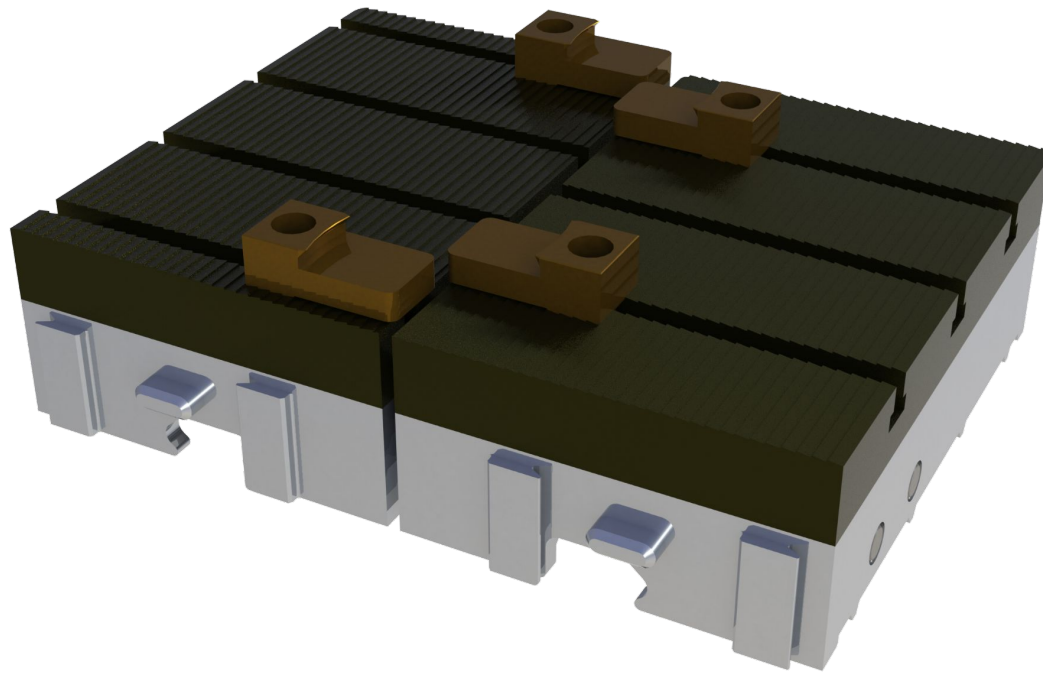

MultiGrip Base Jaws & Universal Top Jaws  
w/ VersaRails

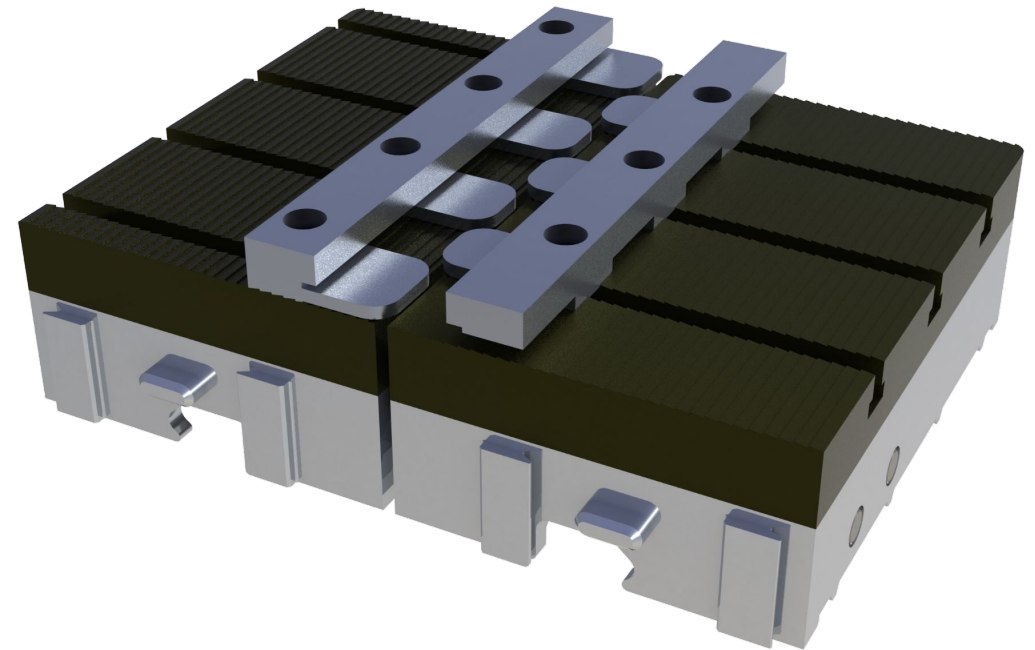


Refer to Universal Jaw Products Manual  
for more information


# MultiGrip Top Jaws

- Part pocket machined into low-cost exchangeable Top Jaws
- MultiGrip Top Jaws snap into place on MultiGrip Base Jaws
- One fixed Top Jaw, one swivel Top Jaw
- Swivel Top Jaw allows jaws to conform to part, increases gripping force on part
- Slightly heavier and slightly taller than MultiGrip Fixed Jaws
- Top Jaws are available in standard and over-sized versions, with thickness of 1.0", 1.5" and 2.0"

Top Jaws are available for OD Jaws only.  
ID Jaws applications use Fixed Jaw.

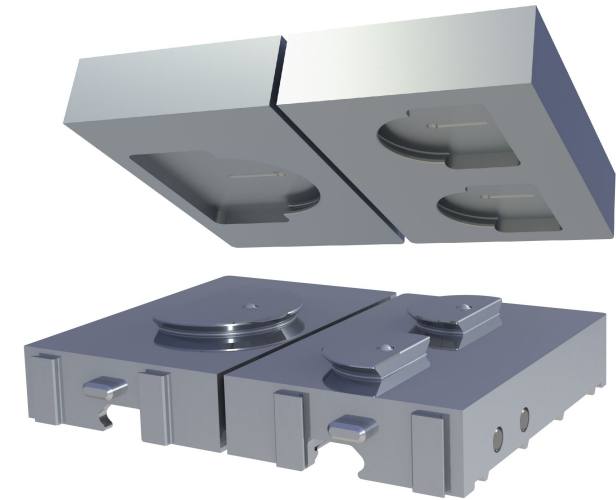

**MultiGrip Top Jaws and Base Jaws**

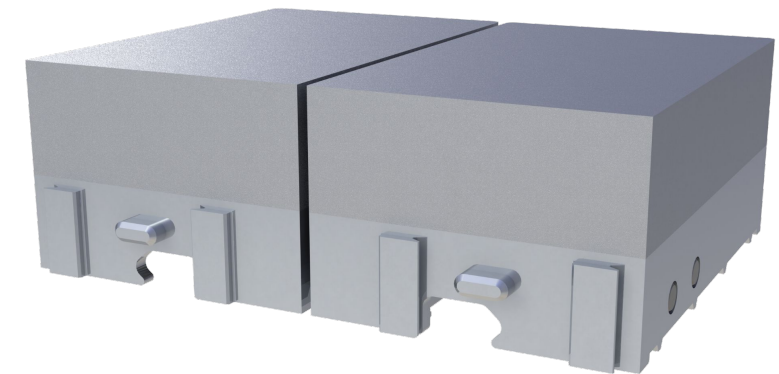


**MultiGrip Top Jaws Mounted on MultiGrip Base Jaws**




# MultiGrip Fixed Jaws

- Solid top surface to machine part pocket
- Typically single part use
- Used when low overall jaw height or lowest jaw weight is required
- Minimum overall height of 1.125"
- Available in **ID and OD** clamping styles
- Available in 1.5" and 2.0" heights
- Considerations must be made to accommodate jaw deflection during gripper pick of rectangular parts (See section Designing MultiGrip Jaws for Picking and Placing for more information)

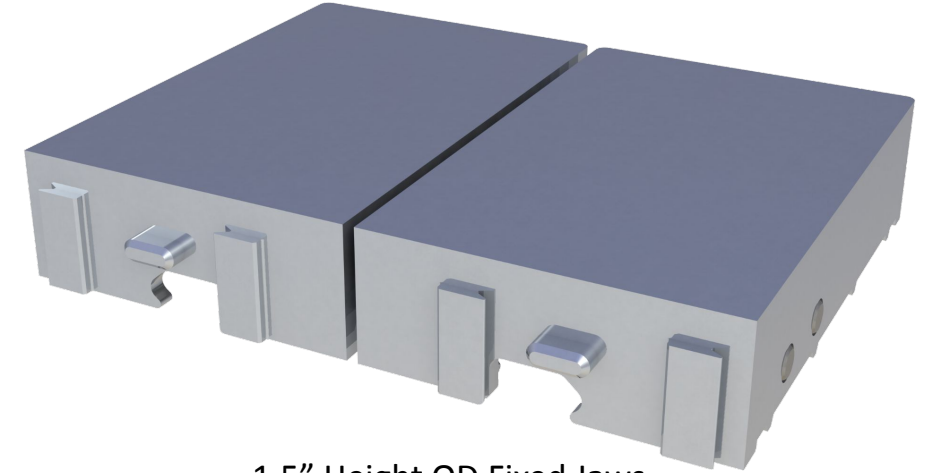


1.5" Height OD Fixed Jaws

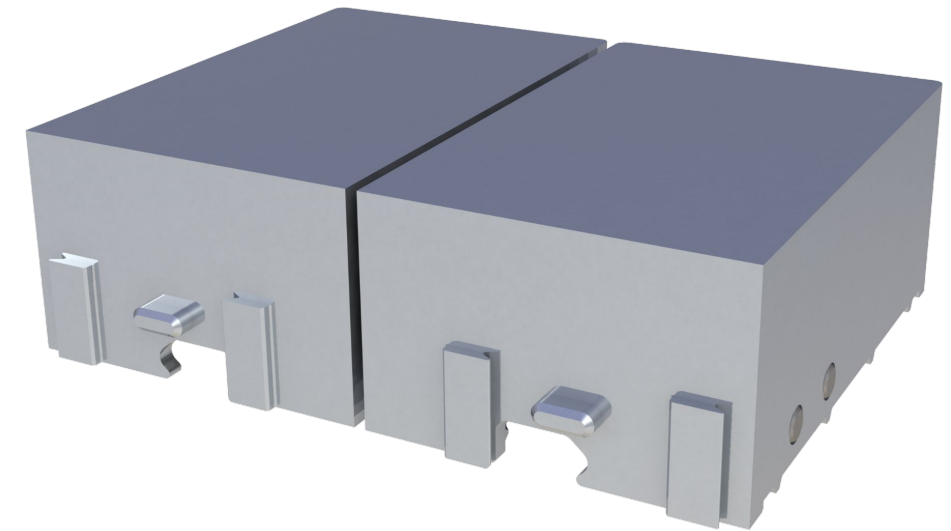

2.5" Height OD Fixed Jaws

# SingleGrip Fixed Jaws


- Solid top surface to machine part pocket
- Typically single part use
- Used for hand loading or robot part loading into jaws that stay resident to the MultiGrip Vise
- Available in **OD** clamping styles
- Available in 1.0", 1.5" and 2.0" heights

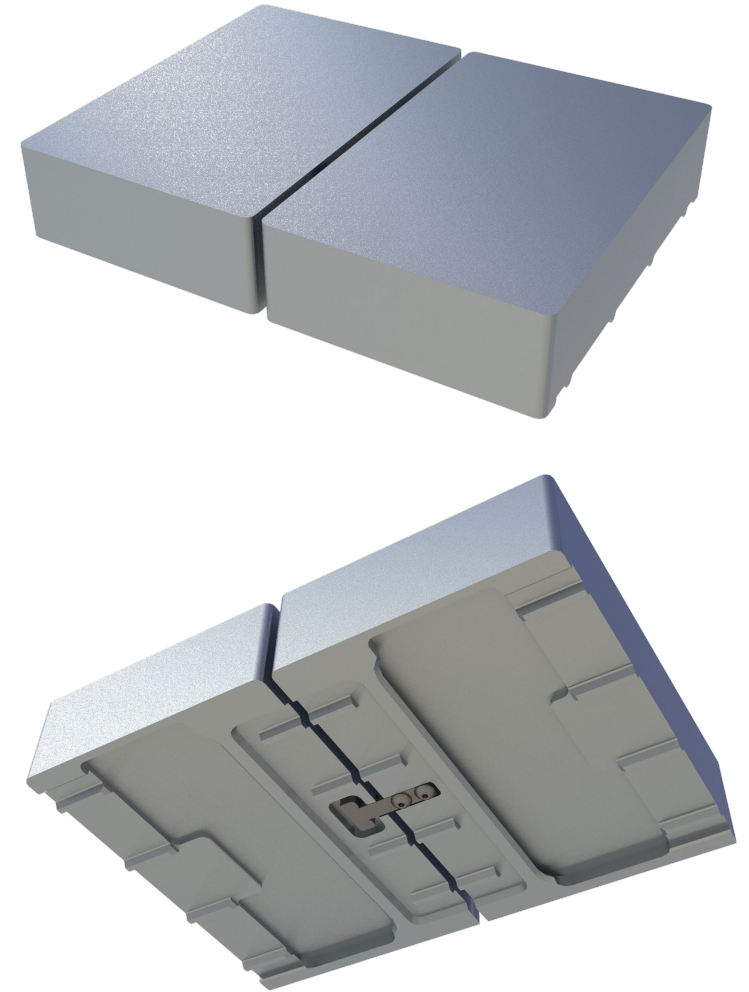

1.5" Height SingleGrip Jaws

# MultiGrip Jaw Setup

- Left and Right Jaws need to include a gap to allow for raw material variations and allow open and close operations for robot processing
- The images to the right show the nominal gaps required

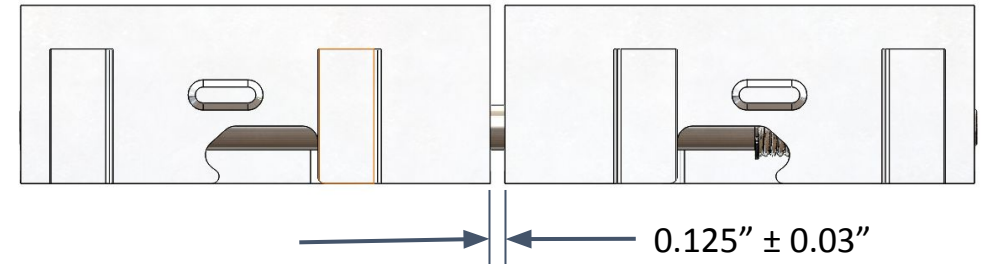


OD Jaws with 0.125" Nominal Gap

Machine Pocket with  $\frac{1}{8}$ " spacer

\*gaps above 0.16" may cause robot load/unload errors due to minimal vise to jaw feature interference

\*gaps under 0.09" may cause vise sensor errors

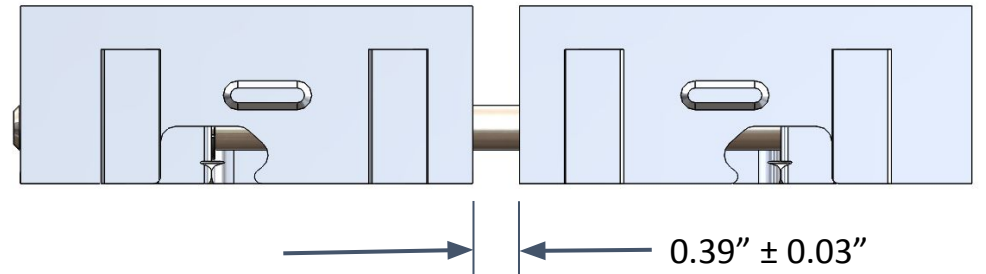

ID Jaws with 0.39" Nominal Gap


Machine Pocket with ID Jaw Fixture

# MultiGrip Jaw Repeatability

- Best repeatability of the MultiGrip workholding system is achieved when MultiGrip Top Jaws are paired with the MultiGrip Base Jaws and the MultiGrip Vise they were originally machined on
  - A good practice is to dedicate at least one set of MultiGrip Base Jaws to each vise
  - Engrave an identifier on each Base Jaw that encodes the CNC machine and vise the Base Jaw is dedicated to
  - When machining Top Jaws, engrave both a part number for the Top Jaws and the identifying number of the Base Jaw it was machined on to make it easy for operators to match the correct Top Jaw and Base Jaw together
- Variability of the position of the MultiGrip jaws between clamping cycles occurs primarily along the X axis
  - The position of the fixed jaw (right jaw) will vary a small amount based upon the clamping pressure applied and the friction between the MultiGrip Jaws and MultiGrip Vise


# Best Practices: Setting the Machining Coordinate System

- When machining raw stock in the first operation, the requirements of the absolute position of the machined part relative to the raw stock are typically low
  - In this case, it is generally safe to use assumed center position of the vise found from the calibration plate in the installation process
- When machining the second operation or any operation in which critical dimensions must be maintained between how the part is held in the jaws and how it is finished
  - In this case best practice is to set the Machining Coordinate system by indicating the fixed (right) MultiGrip Jaw

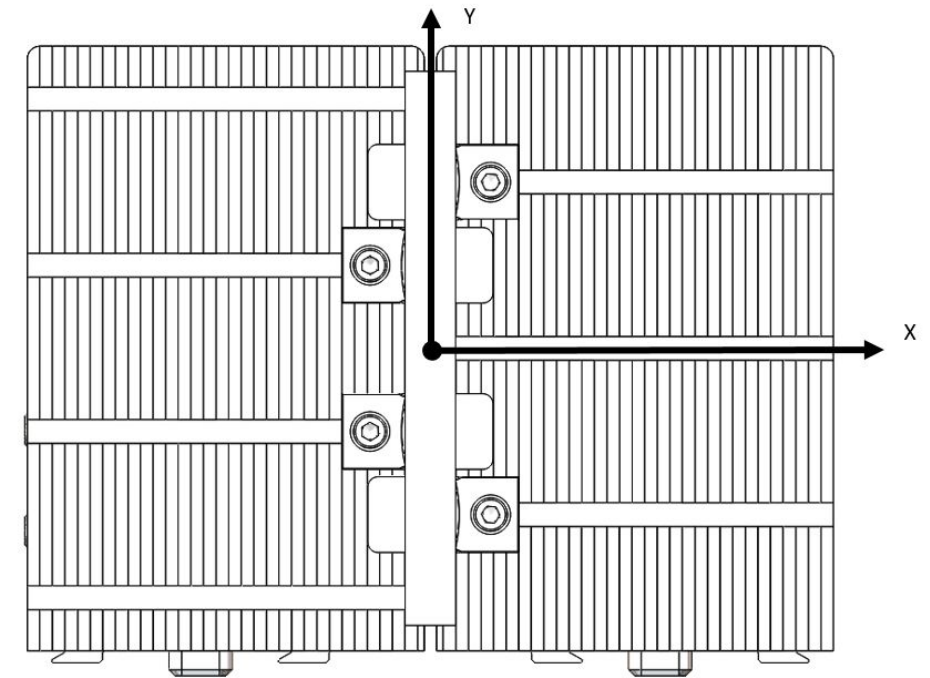

# Best Practices: Using Fixtures That Bite into Raw Material


- When clamping raw stock using VersaBites, the part will shift to the right a small amount when clamped
- If the part boundaries are close to the width of the part, it may be necessary to offset the coordinate system to the right to compensate
- VersaBuilt recommends using a probe to center the work coordinate system in X when part boundaries are close to raw material boundaries
- To measure the shift of the part without a probe, place the raw material in the jaws and push the part to the right against the VersaBites; measure the distance from the right side of the part to the edge of the right jaw
- Clamp the part with the vise and measure the difference in distance

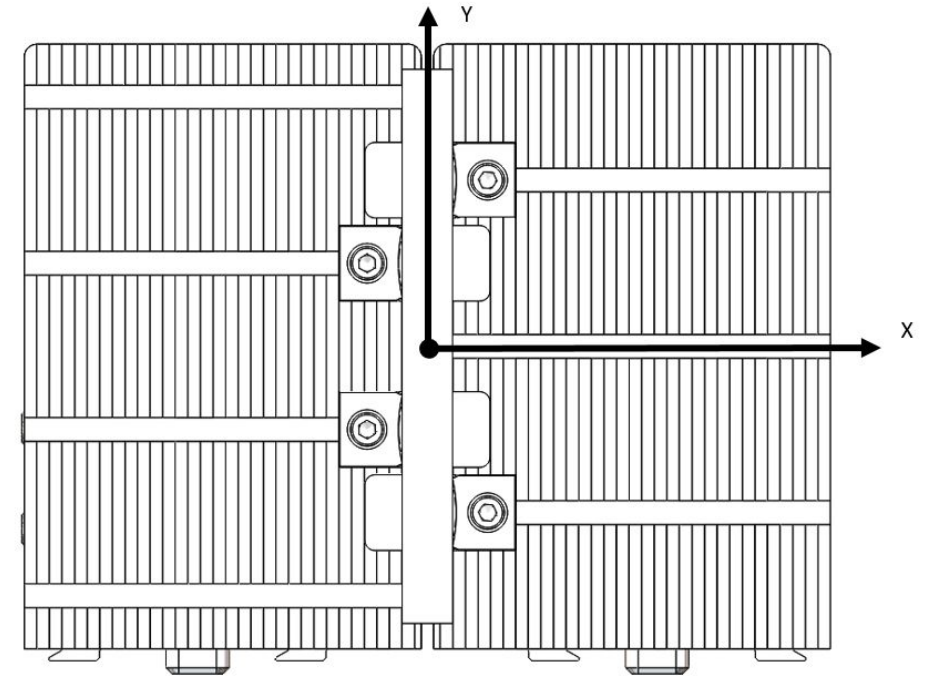

# Best Practices: Indicating MultiGrip Jaws

Indicating MultiGrip Jaws in preparation for cutting new MultiGrip soft jaws:

- Start with the vise home position found during vise setup and installation (see installation manual)
- Set the the vise air pressure to the clamping pressure that will be used during the machining process
- Turn on CNC coolant so the MultiGrip vise is covered in coolant
- Place the jaws on the MultiGrip vise and clamp the vise with the 1/8" machineable spacer installed
- Indicate the X position of the Machining Coordinate System from the right Top Plate or MultiGrip Jaw as shown
- If you prefer to set the CAM coordinate system to the center of the jaws, shift the measured X value 4" to the left
- Generally, variability in Y is minimal and does not require a change from the vise home position

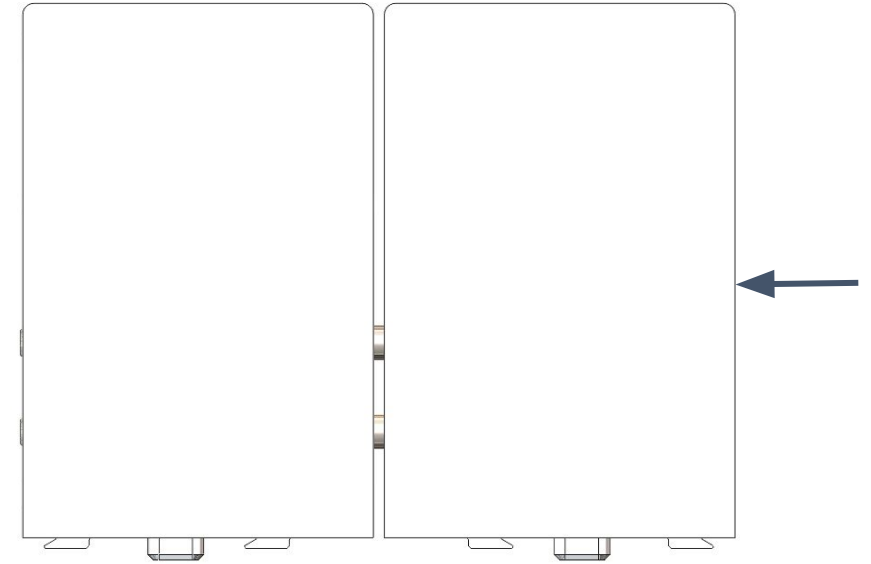

# Best Practices: New MultiGrip Jaw Break-in

- New MultiGrip Fixed Jaws or MultiGrip Base Jaws have a break-in period
- During the break-in period the position of the jaws after each clamping cycle will move more than after the break-in period
- After the break-in period, MultiGrip Jaws will generally repeat to position within 0.0005" between clamping cycles
- Most of the break-in movement takes place in the first 100 open/close cycles when the jaws will move primarily in X
- Jaws can be broken in by hand by first soaking the vise with coolant and then clamping empty jaws in the vise, using a dead blow to move the right jaw off the dovetail after each open
- Alternatively, indicate the position of the jaws with a spindle probe before each machining cycle
- See next page for chart details



# Dry Machining with MultiGrip


- MultiGrip relies on CNC coolant to lubricate the vise interface, the gripper interface and the jaws
- If possible, run a vise wash program with coolant after the dry machining is completed to wash away chips and lubricate the vise, gripper and jaws
- If no coolant is available, use of a dry lubricant is required to be applied at least daily to the vise interface, gripper interface of the jaws, cross-pins of the jaws, and the face of the gripper

# MultiGrip Jaw Design and Machining

## Section 4

# MultiGrip Jaw Guidelines

- Designing and cutting MultiGrip Jaws should follow the same best practices used with any other vise soft jaw.
- Design MultiGrip Jaws that will be rigid enough for the intended machining operations and capable of reliably picking, transferring or placing parts.
- The following pages include MultiGrip specific guidelines for:
  - Nominal Gap
  - Pick/Place Clearance
  - Jaw Pocket Depth
  - Top Jaw selection and design
  - Lightweight parts
  - Jaw Deflection

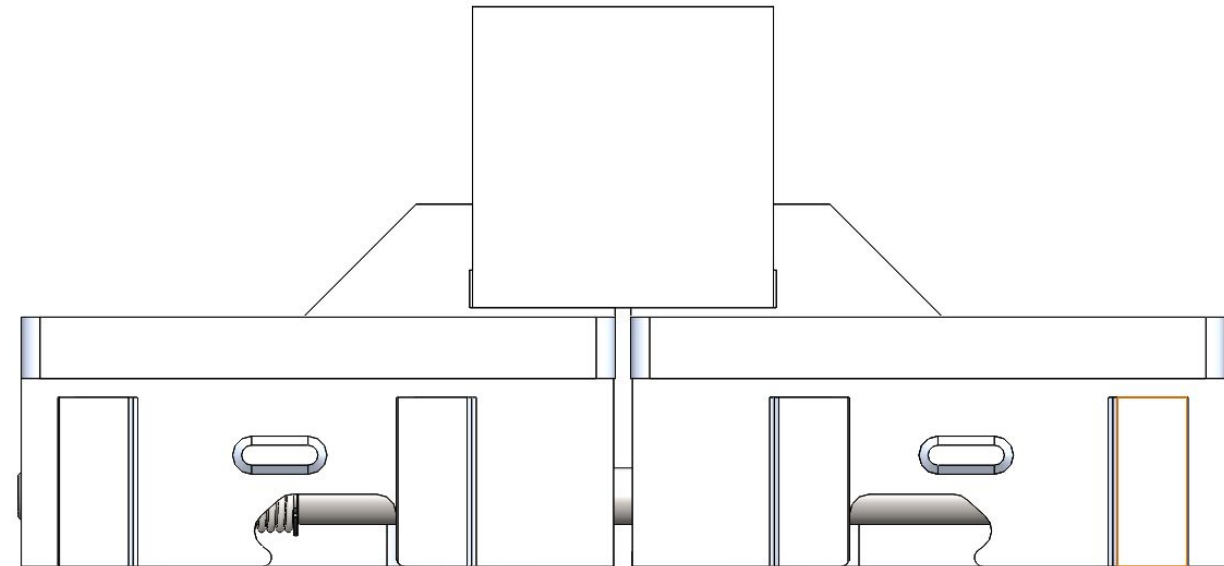

Example - OD Base Jaws with 1.5" Top Jaws cut to hold 2x2" material

Jaw design examples are shown in the appendix

# MultiGrip Jaw Guidelines

- **MultiGrip Jaws Guidelines:**


- Nominal Gap between left and right jaws
  - 0.125" for OD Jaws
  - 0.39" for ID Jaws
- Pick Clearance:
  - X-direction clearance - 0.750" Max side wall
  - Y-direction clearance - 0.125" Max side wall
- Jaw Pocket Depth
  - 0.125" for picking parts from infeed
  - 0.100" for subsequent operations
- Jaw selection and design
  - Replaceable top jaws are a convenient way to introduce a high-mix of parts
  - For part lengths greater than 3", swivel top jaws are recommended, less than 3", we recommend fixed-fixed
- Lightweight parts:
  - Lightweight parts may stick to the z-surface of jaws, due to surface tension, not allowing for reliable part drop-off
  - Minimize z-surface-area by machining z-pads, rather than leaving the entire surface
- Jaw deflection:
  - Clamping forces from the vise to the jaw are on the bottom side, resulting in moment about the dovetail interface. The moment is greater as jaws are taller.

The following pages go into detail for each of these guidelines


to clear adjacent parts on VersaCart

# MultiGrip Jaw Guidelines

- **Nominal Gap between left and right jaws**
  - Before cutting MultiGrip jaws, with fresh coolant on the vise, load the empty jaws into vise and cycle the jaws open and closed several times
  - For OD Jaws, position the included 0.125" wide machinable jaw spacer in the jaws so that the bottom of the jaw spacer is between 0.125" and 0.250" below the lowest part of the jaw pocket to be cut.
  - For ID Jaws, position the ID Jaw Fixture (P/N 5007434) around the lower section of the jaw (near the top of the Gripper interface features), then open vise against the Fixture stops to set the jaw gap. This sets the nominal gap to 0.39".
  - Before machining the jaw pocket, set the vise clamping pressure to the intended clamping pressure during automated processing or the maximum clamping pressure of the vise

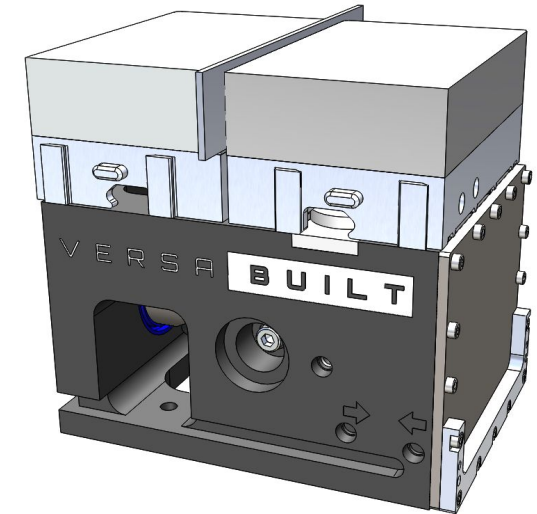

OD Jaws with 1/8" spacer

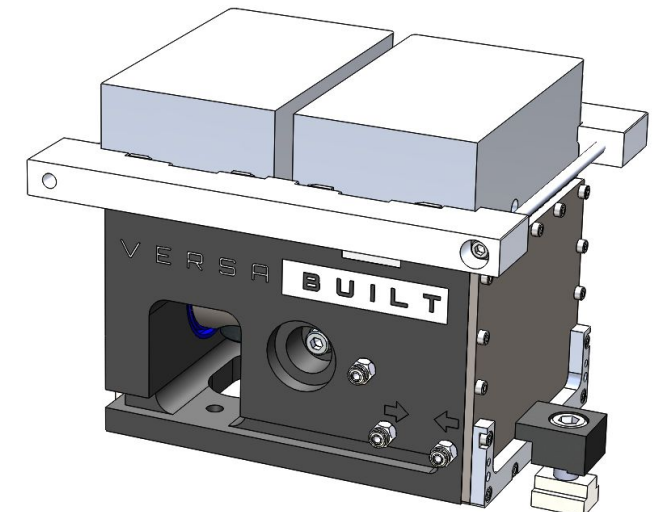


ID Jaws with ID Jaw Fixture


# MultiGrip Jaw Guidelines

- **Pick Clearance (avoid part interference while picking):**


- Design the part pocket so that when the jaws are fully open, there is adequate clearance between the the part and pocket
- Avoid pocket features that approach parallelism with the X plane of the jaws
- For round parts we recommend a 90 degree clearance cut along both sides of Y axis

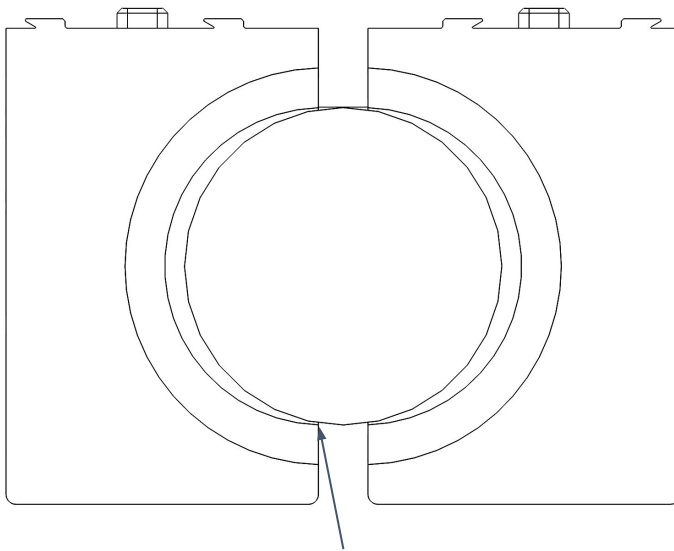

Not enough clearance between part and jaws during pick

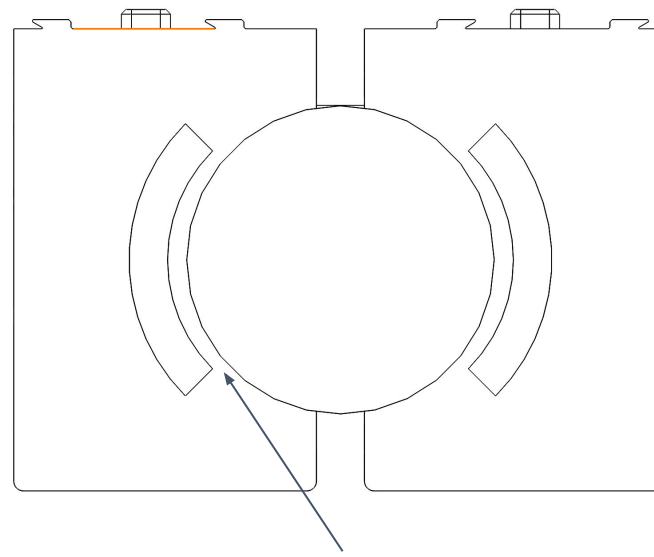



Enough clearance between part and jaws during pick

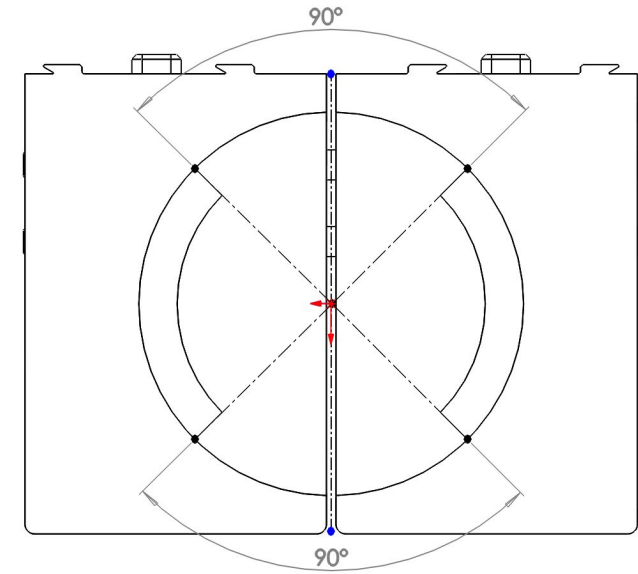

90 degree cut along Y axis for part clearance

# MultiGrip Jaw Guidelines


- **Pick Clearance (avoid part interference while picking):**
  - Consider the jaw stroke and nominal clamp positions during pick
  - OD jaws max opening = 0.75" (~20mm), nominal vise clamp = 0.125"
  - ID jaws min closing = 0.0", nominal clamp = 0.394" (10mm)

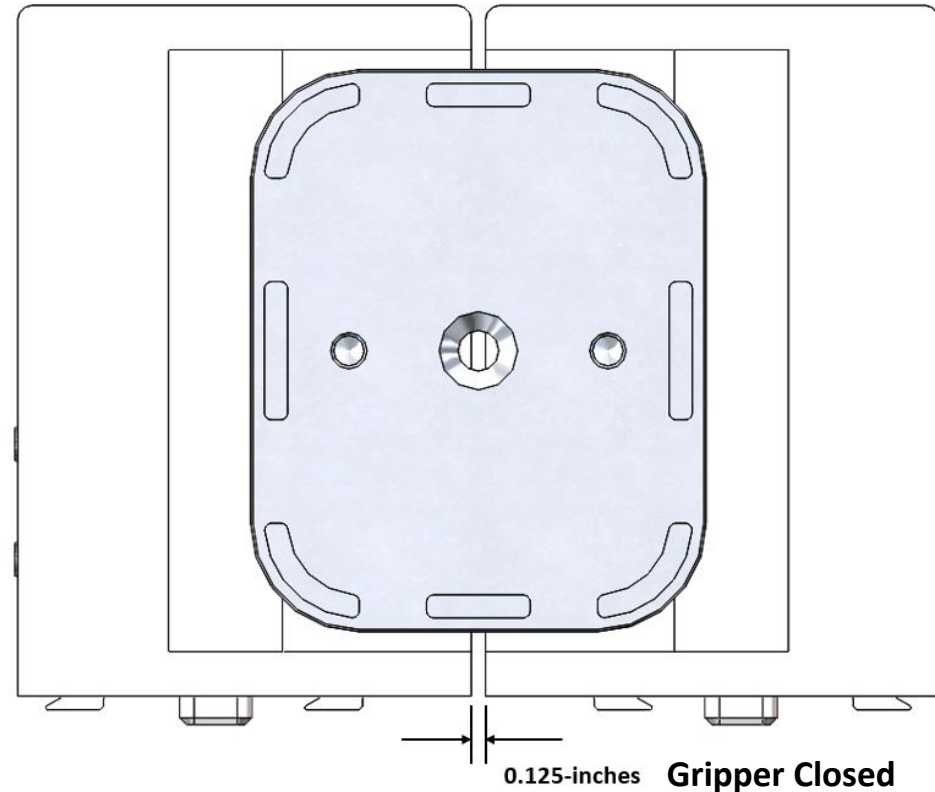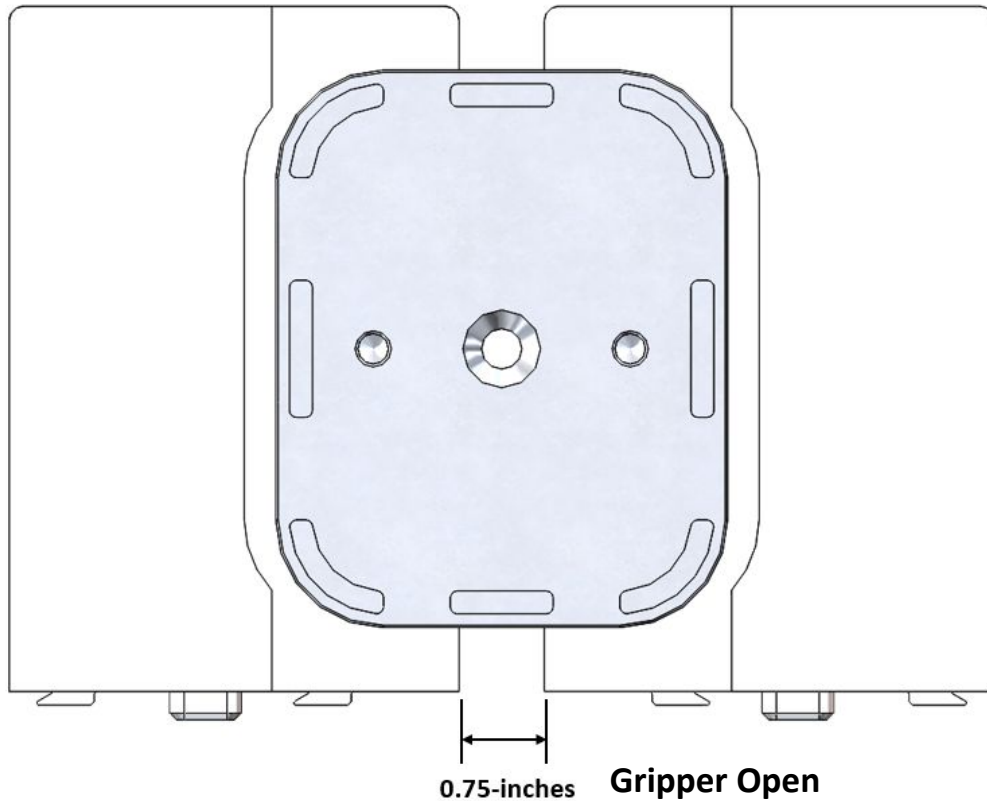

# MultiGrip Jaw Guidelines

- **Pick Clearance (avoid neighbor interference on VersaCart):**

- Maximum X-direction sidewall = 0.75-inches
- Maximum Y-direction sidewall = 0.125-inches

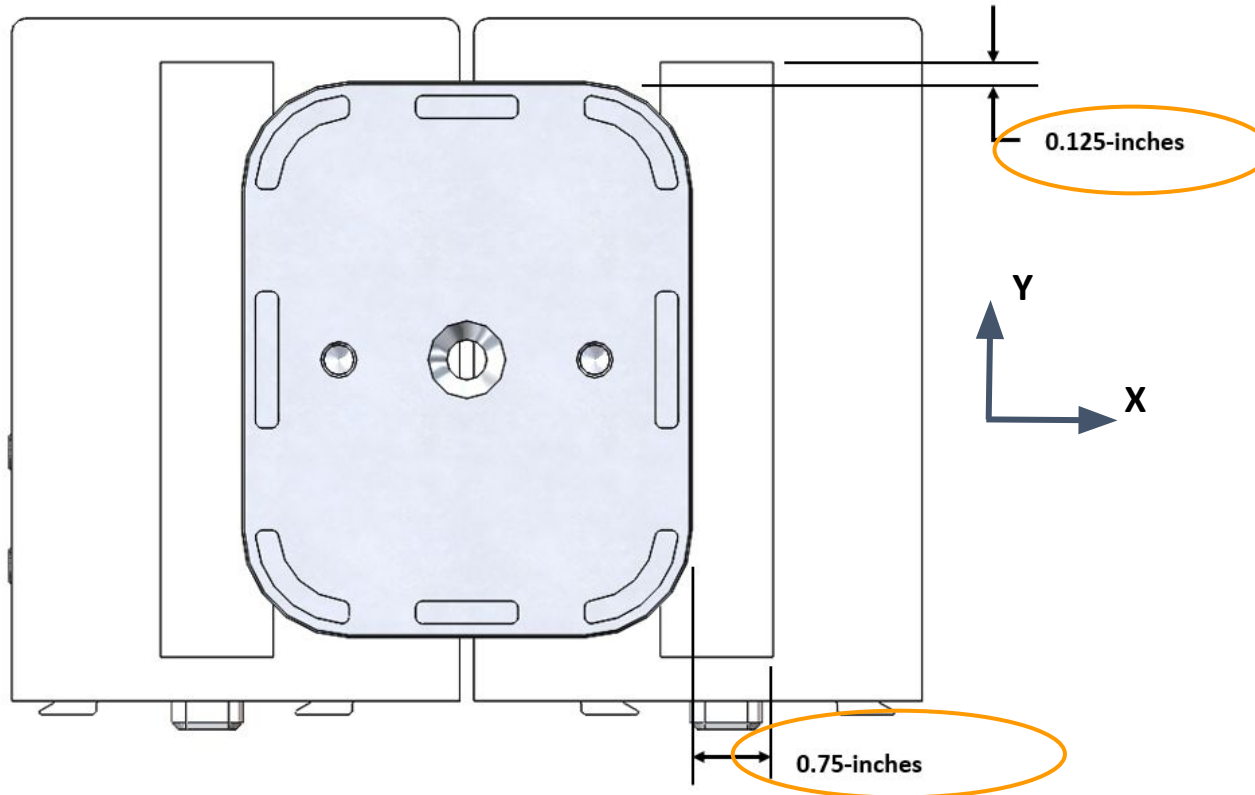

**Default layout of parts on the VersaCart are arranged for maximum density, assuming the sidewall dimensions shown.**


**If you cannot design your jaws with minimized sidewalls, the layout of parts on the VersaCart will need to be changed to a lower density to clear the full jaw size.**

**Refer to the VSC Mill Operators Manual for information about custom part spacing.**




# MultiGrip Jaw Guidelines

- **Pick Clearance (avoid neighbor interference on VersaCart):**
  - Include Z-clearance between the jaw and adjacent parts on the VersaCart during picking of raw material and place of finished parts
  - Clearance needs to be in X and Y Directions
  - The image below shows placing a finished part on the VersaCart, with X-Clearance to clear adjacent raw material

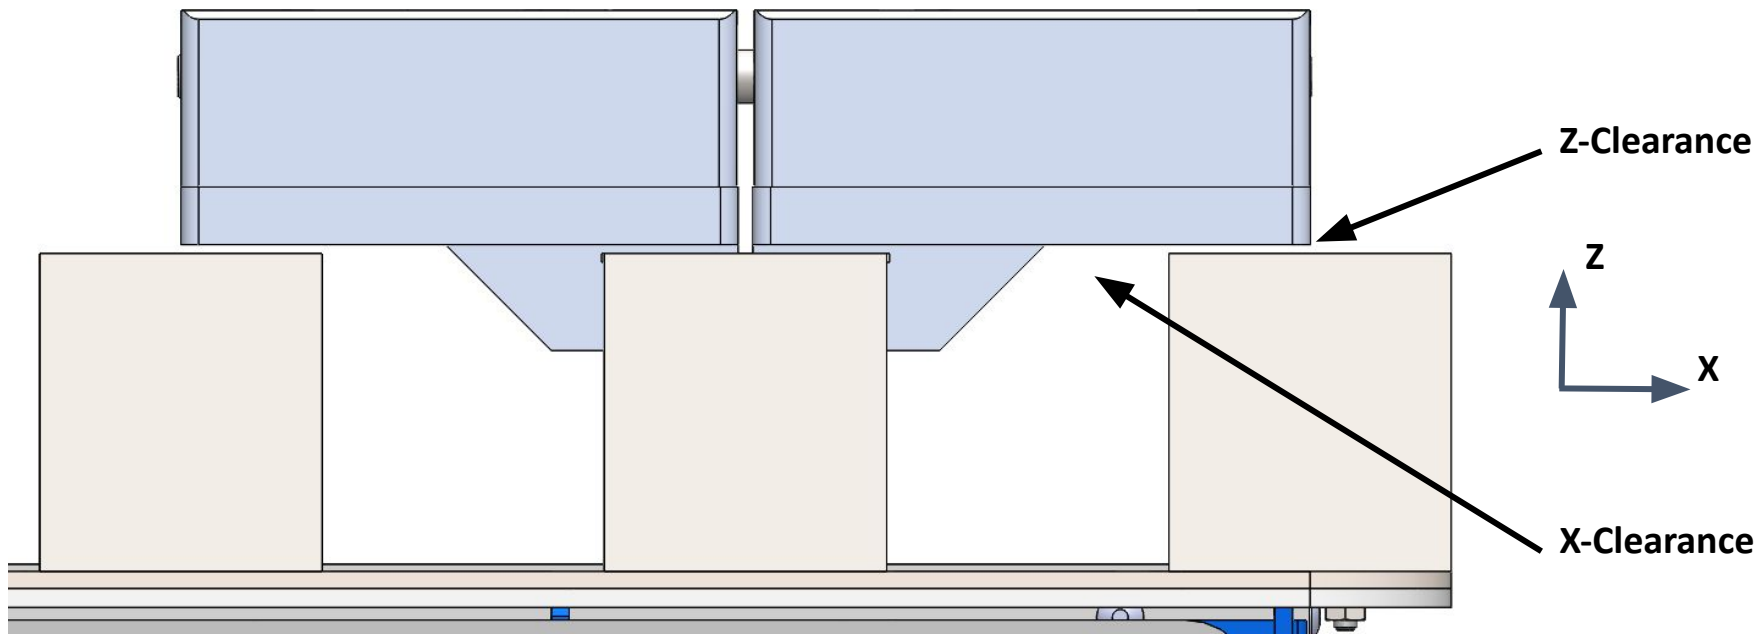

# MultiGrip Jaw Guidelines


- **Pick Clearance (avoid neighbor interference on VersaCart):**
  - The image below shows placing a finished part on the VersaCart, with Y-Clearance in the jaw pocket to clear adjacent raw material

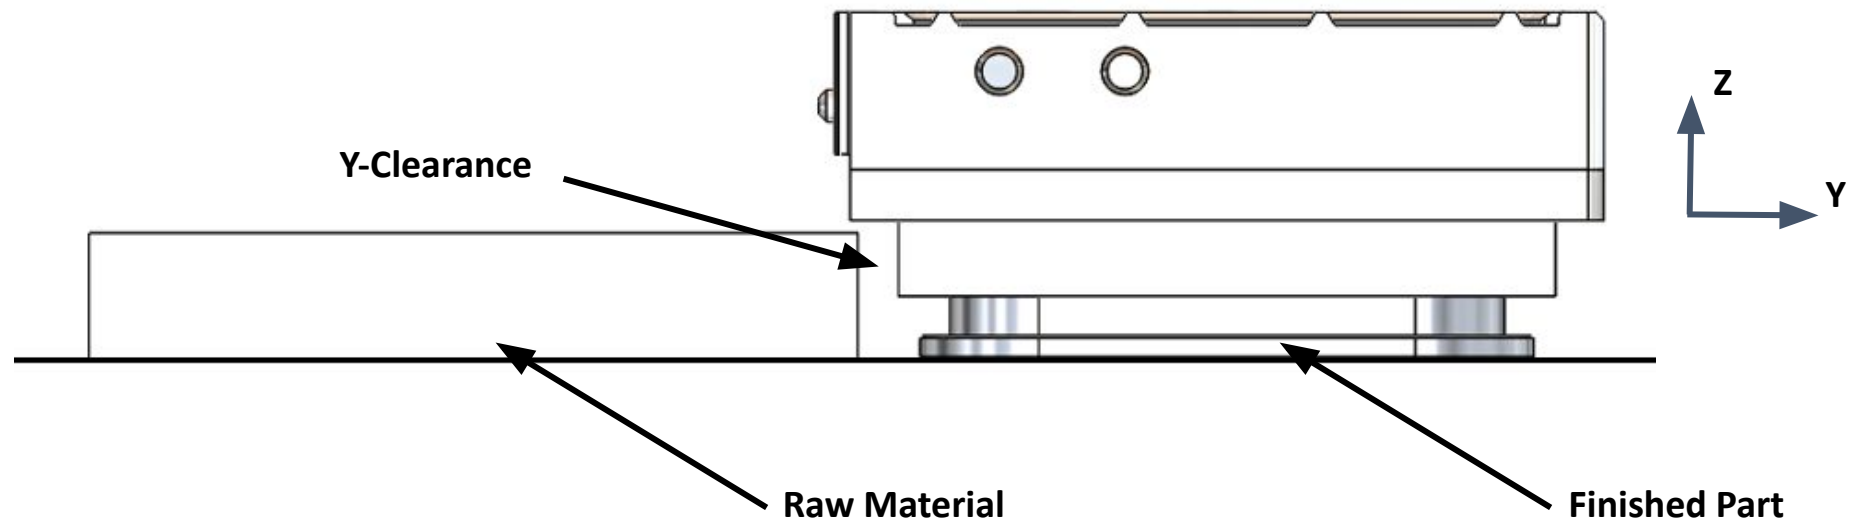

# MultiGrip Jaw Guidelines

- **Jaw Pocket Depth**

- For OP1 jaws that will pick the part from infeed, we recommend a minimum pocket depth of 0.125".
- For process reliability, wherever possible, consider a greater clamping depth for Op1 picking.
- Using the "Part Find" option in the part configuration can aid a shallow depth of pick.
- For OP2 jaws that will be used to transfer the part from OP1, we recommend a minimum pocket depth of 0.100" (2.5mm).

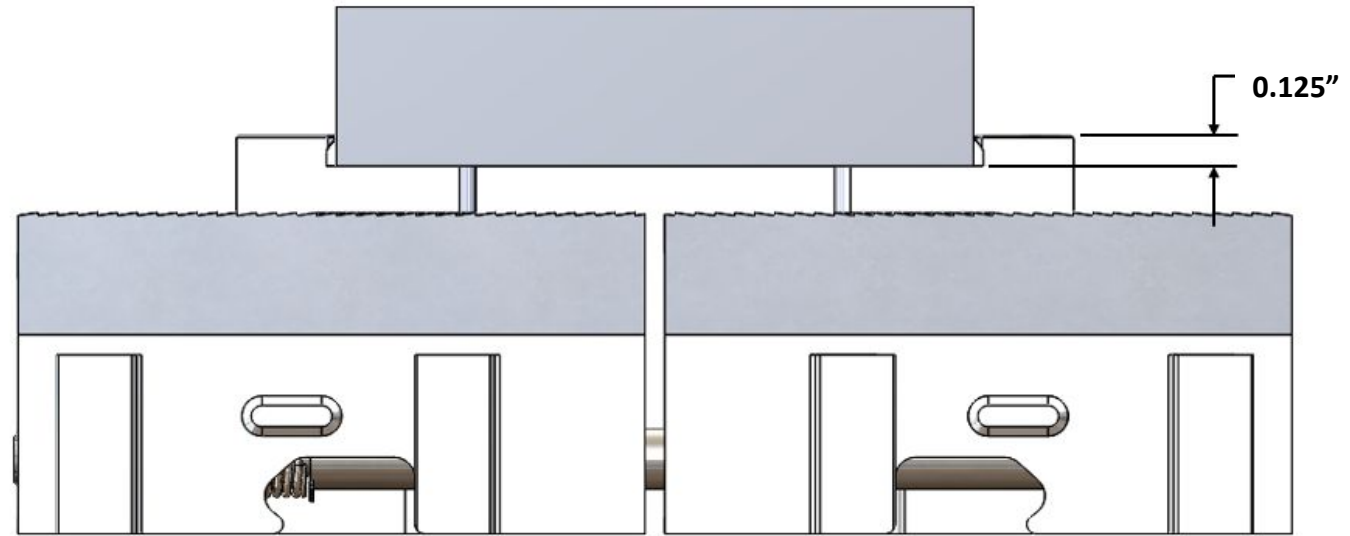

# MultiGrip Jaw Guidelines

## Jaw Design:

There are multiple options for workholding design with MultiGrip and selection of the type of jaws depends on the needs of the application. Jaw types are:

- Swivel-Fixed Top Jaws
- Fixed-Fixed Top Jaws
- Fixed Base Jaws
- OD/ID Jaws
- Jaws with steel inserts
- Jaws with Y-locator
- Jaws with overlapping Z-surface
- Large Parts

Jaw selection depends on part geometry, part height, part material type, desired clamping locations, process reliability and part precision.

The following pages outline the benefits of each type.


Vise and Jaw files available for download from [www.versabuilt.com/resources](http://www.versabuilt.com/resources)

**Jaw design examples are shown in the appendix**


# Jaw Design - Swivel-Fixed Top Jaws

## Swivel-Fixed Top Jaws:

- Swivel-Fixed Top Jaws are the most common type of jaws used MultiGrip workholding applications
- The Top Jaws are composed of a “swivel” jaw on the left side and a “fixed” jaw on the right side
- The Swivel side allows for the jaws to conform to material variation and imperfections
- Jaw design for rectangular parts should promote rotation/swivel of the left jaw with a part interface outside the radius of the swivel features on the base jaw/underside-pocket. The swivel feature radius is 1.4-inches. If the clamping interface of the part is less than 3.00-inches apart, the lever to rotate the swivel jaws may not be sufficient for swiveling.
- Recommended **minimum part length for Swivel-Fixed Jaws is 3.5-inches** (allowing the distance of the clamping features on the jaws to be greater than 3.0-inches)

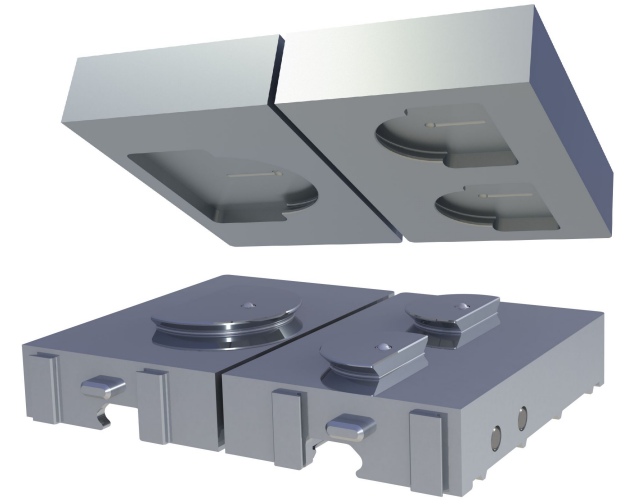



**MultiGrip Top Jaws and Base Jaws (Swivel-Fixed)**

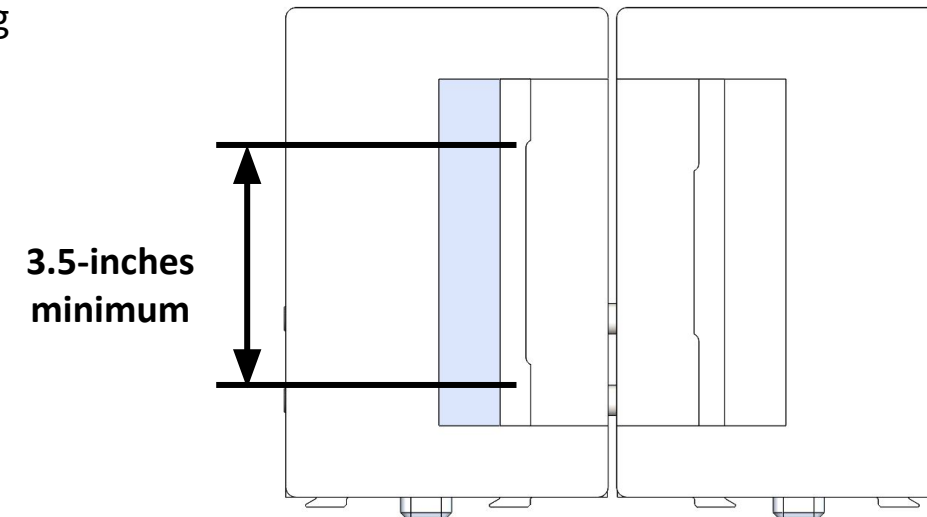

# Jaw Design - Fixed-Fixed Top Jaws

## Fixed-Fixed Top Jaws:

- Fixed-Fixed Top Jaws are an alternative to Swivel-Fixed Jaws, when the swivel functionality is not desired or if the part length limits swivel capability.
- The Top Jaws are composed of a “fixed” jaw on the left side and a “fixed” jaw on the right side
- Recommended **for parts with length less than 3.5-inches**, rather than Swivel-Fixed Top Jaws.

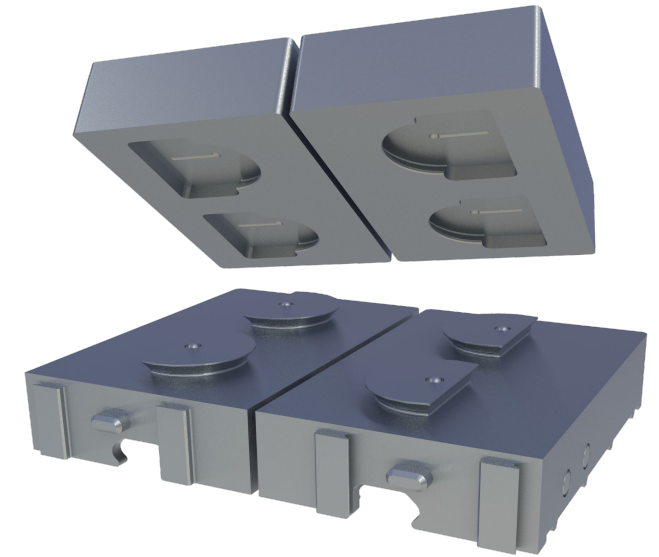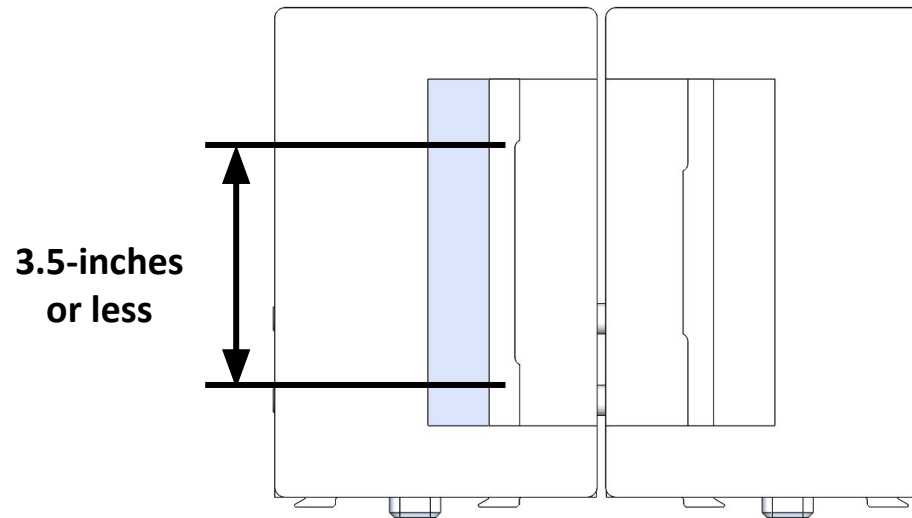


**MultiGrip Top Jaws and Base Jaws (Fixed-Fixed)**


# Jaw Design - Fixed Base Jaws

## Fixed Base Jaws:


- Fixed Base Jaws provide an opportunity to make lower-profile jaws or maximize clearance for machining 4 or 5 axis parts, where tool clearance is important
- Fixed Base Jaws can also be used to bolt-on custom jaw tops

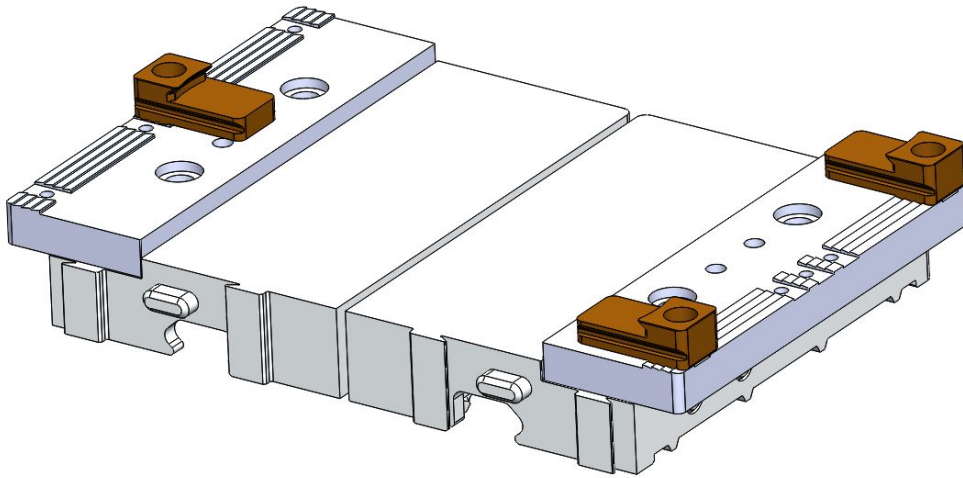

Example Jaw - 1.5" Fixed Jaws with custom top w/  
VersaBites for 10-inch wide raw material

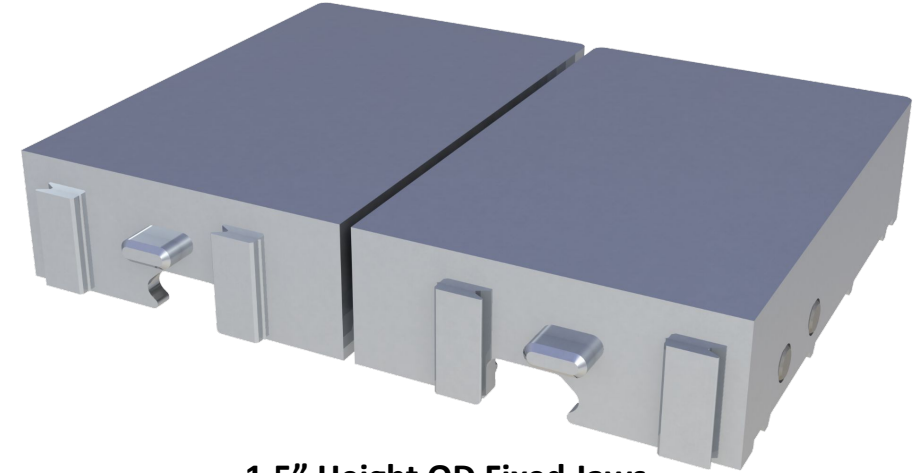

1.5" Height OD Fixed Jaws

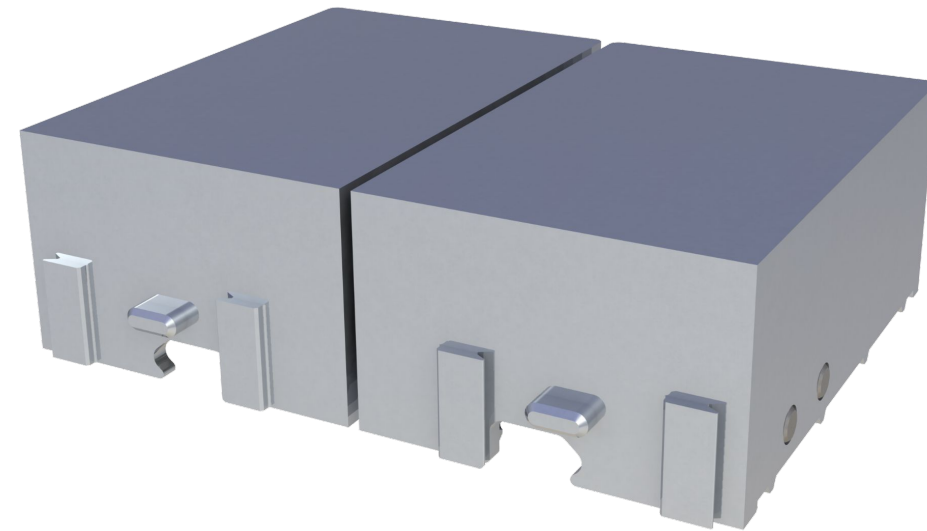


2.5" Height OD Fixed Jaws

# Jaw Design - OD/ID Jaws

## OD/ID Jaws:

- MultiGrip Jaws are available in OD (outside clamping) or ID (inside clamping) types.
- OD Jaws have a nominal clamping distance between the left and right jaw of 0.125-inches
- ID Jaws have a nominal clamping distance between the left and right jaw of 0.39-inches and require an ID Clamping Setup Fixture to set the nominal clamping distance while machining the jaws
- Factors in determining which jaw type can be:
  - Part geometry
  - Part strength/deformation during clamping
  - Tab-out machining
  - Clamping clearance

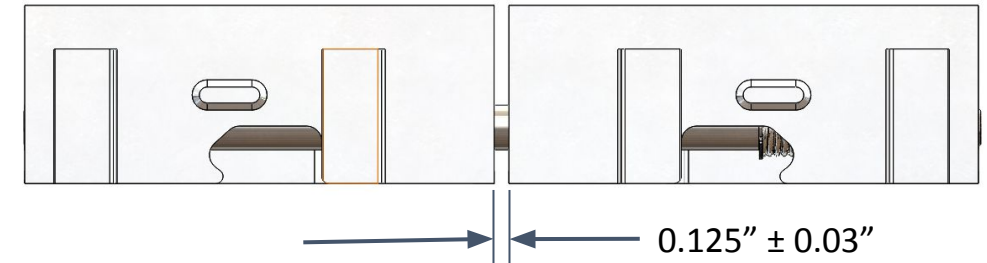


OD Jaws with 0.125" Nominal Gap

Machine Pocket with 1/8" spacer

\*gaps above 0.16" may cause robot load/unload errors due to minimal vise to jaw feature interference

\*gaps under 0.09" may cause vise sensor errors

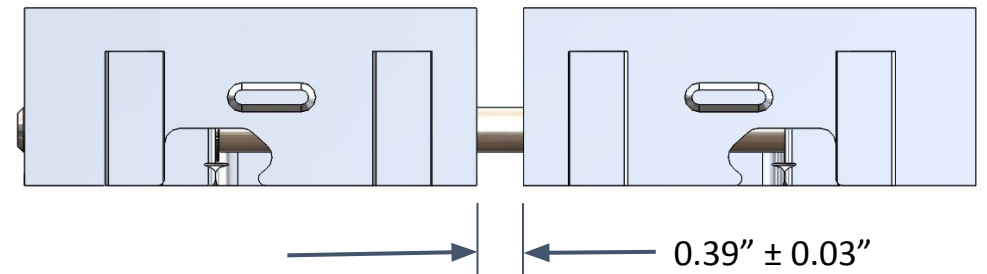

ID Jaws with 0.39" Nominal Gap


Machine Pocket with ID Jaw Fixture



# Jaw Design - Jaws Inserts

## Jaws Inserts:

- MultiGrip Jaws are composed of 6061 aluminum
- For applications requiring a harder/more durable interface between the part and the jaws, we recommend adding an insert, bolted to the MultiGrip Jaws, with the insert composed of a hard material to mitigate wear or durability concerns

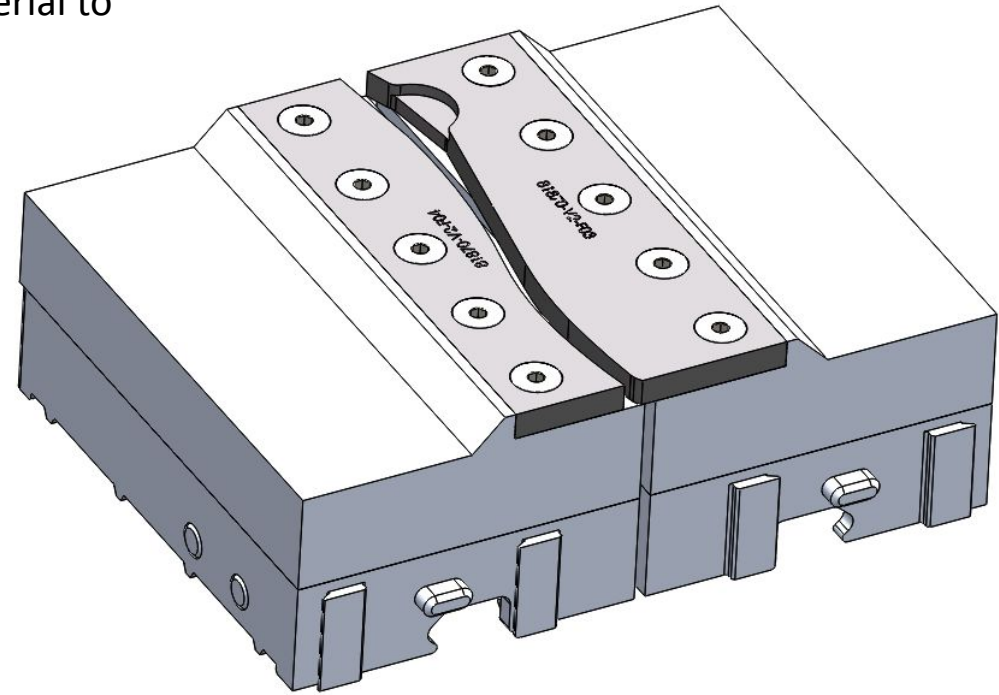


Example Jaw - Hardened Steel Insert for Stainless Steel Parts

# Jaw Design - Overlapping Z-Surface

## Overlapping Z-Surface


- For applications with narrow parts or parts with tight parallelism or flatness requirements, overlapping z-surfaces may be required.
- VersaRails are available for narrow parts with interlaced z-surfaces.
- Custom jaws with an overlapping z-surface, where the part rests on a single z-surface (rather than a left and right surface) can aid parallelism or flatness needs.

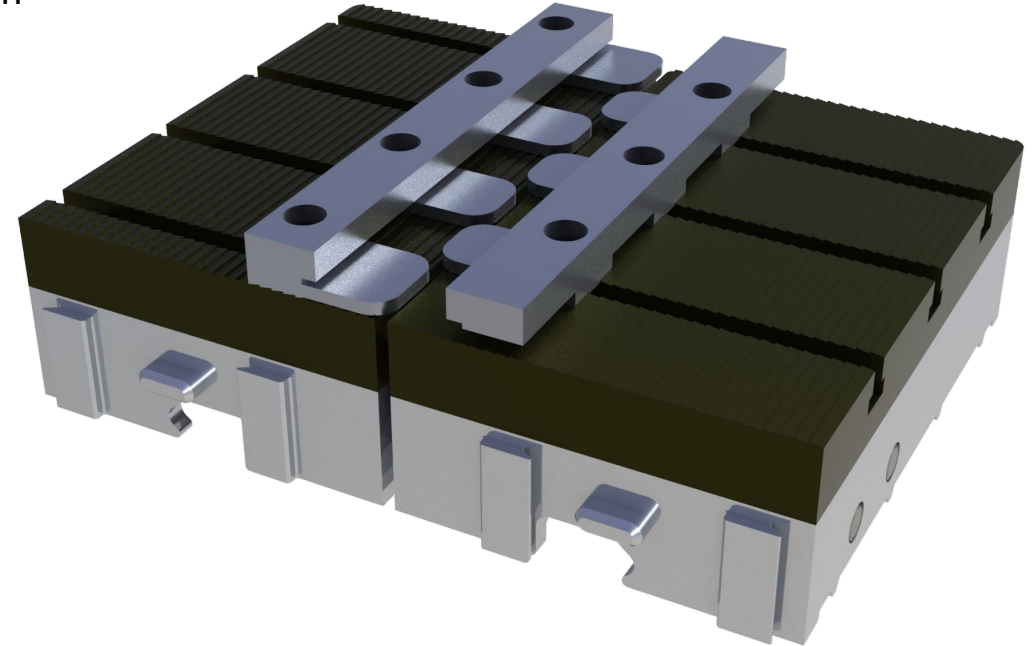


Example Jaw - Universal Top Jaws w/ VersaRails

# Jaw Design - Overlapping Z-Surface

- Generally, parts less than 1.625" wide cannot be settled using Gripper or Vise Settle with standard MultiGrip Jaws (opening and closing jaws to seat the part in Y and/or Z)
- When the gripper opens, the gap between the jaws is 0.80" and the part may fall into the gap
- Adding an overlapping bridge into your MultiGrip Jaws or using Universal Top Jaws with VersaRails prevents the part from falling into the open gap during a settle operation
- The first example to the right shows 2 bridges bolted into place, then machined for clamping a 0.50" part
- The second example shows VersaRails in the 1.5" position (refer to the Universal Jaw Products manual for more information)

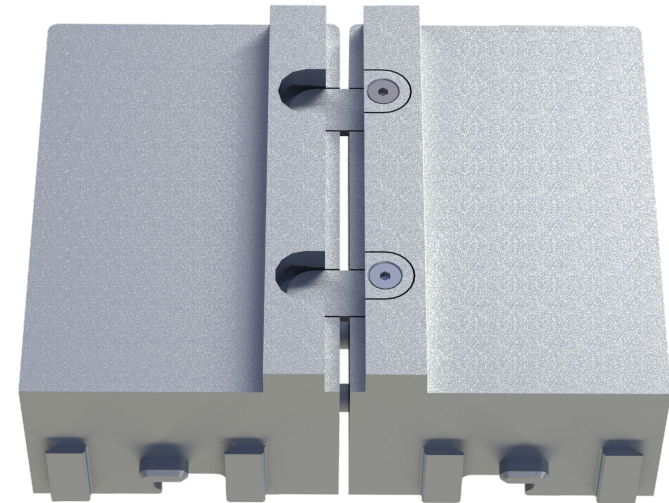


MultiGrip Jaws with 2 Bridges

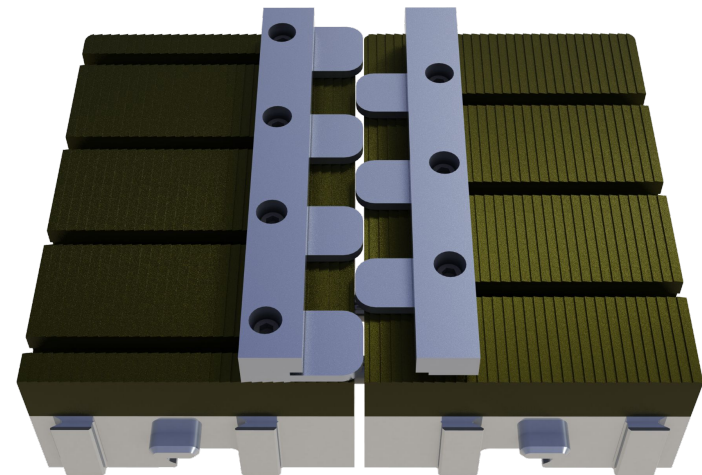

Universal Top Jaws with VersaRails

# Jaw Design - Lightweight Parts


- Lighter parts with lots of surface area between the part and jaws in a machining environment that uses coolant may not release from the jaws during place
- When machining lighter parts with large surface areas, minimize surface contact between part and jaws
- Use “pads” in Z and X clamping surfaces as necessary to reduce surface area:

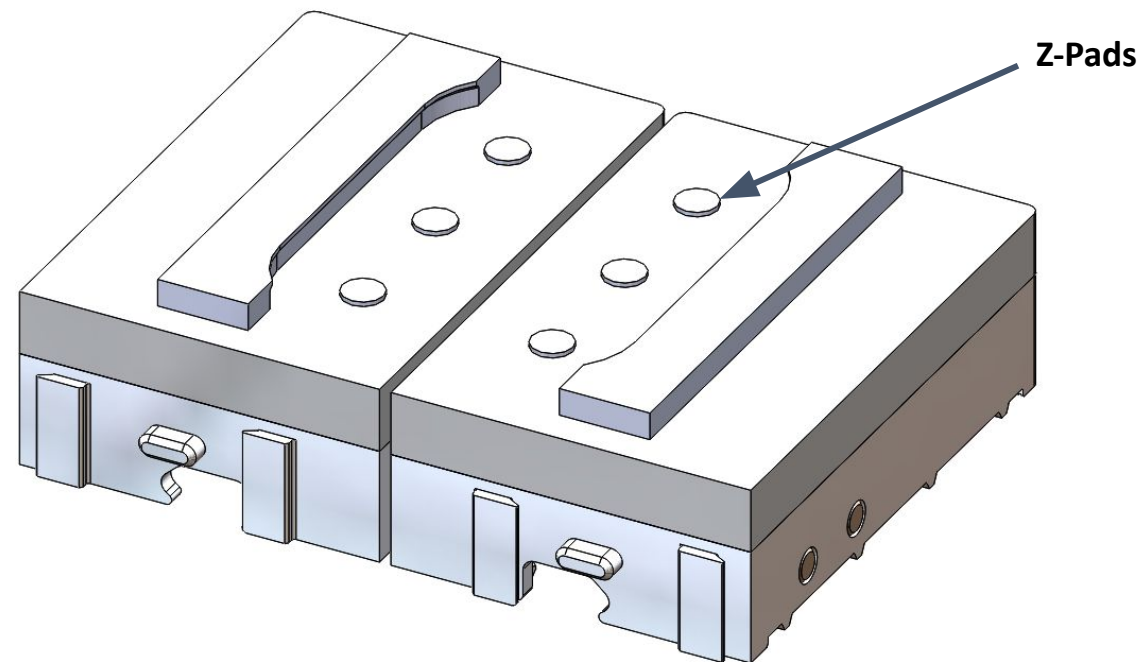

# Jaw Design - Fixed Jaws Deflection During Pick


- MultiGrip **Fixed Jaws** will deflect a small amount during part grip\* and with parallel wall jaws. *The MultiGrip Gripper interfaces with the jaws at the front of the jaws, causing a small “V” and can result in poor picking results (see the following page for fixed jaw pocket design for rectangular parts)*
- MultiGrip Top Jaws include a fixed jaw and a swivel jaw; the swivel jaw is designed to rotate to ensure full part contact with the part during part pick as the jaw deflects
- MultiGrip Fixed Jaws do not have a swivel jaw and will not be able to pick some part shapes without additional considerations, like 3-points of contact (shown on the following page)

\* Jaw deflection shown does not occur when MultiGrip Jaws are loaded into a MultiGrip Vise. MultiGrip Base Jaws with Top Jaws accommodate jaw deflection

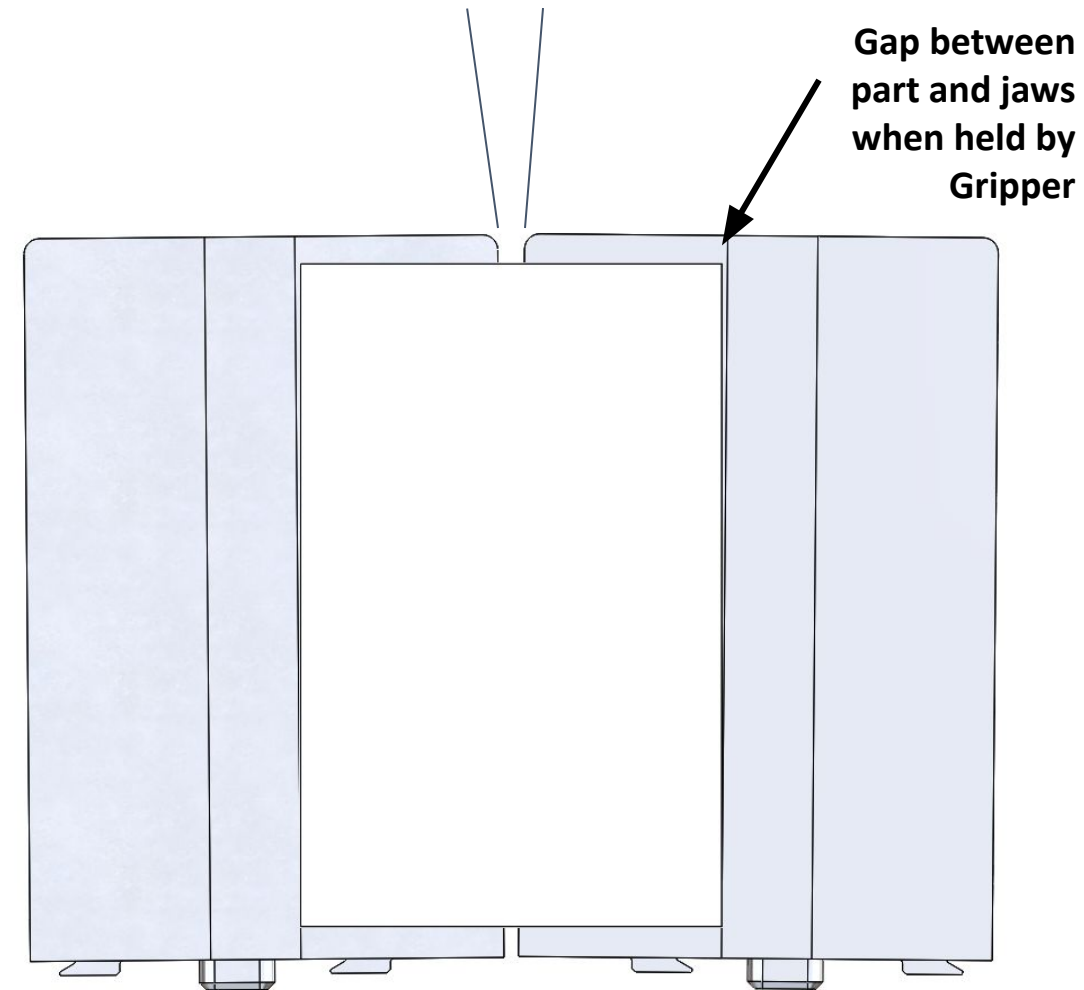

# Jaw Design - Fixed Jaw Deflection During Pick

- When using MultiGrip Fixed Jaws with rectangular parts, triangulation of the jaw pocket will provide good results during pick, fully constraining the part in 6-degrees of freedom.
  - Z-surface - 3-points of contact (Plane)
  - Left Jaw - 2-points of contact (Line)
  - Right Jaw - 1 point of contact (Point)
- Triangulation of the of the jaw pocket is not necessary for round parts using MultiGrip Fixed Jaws.

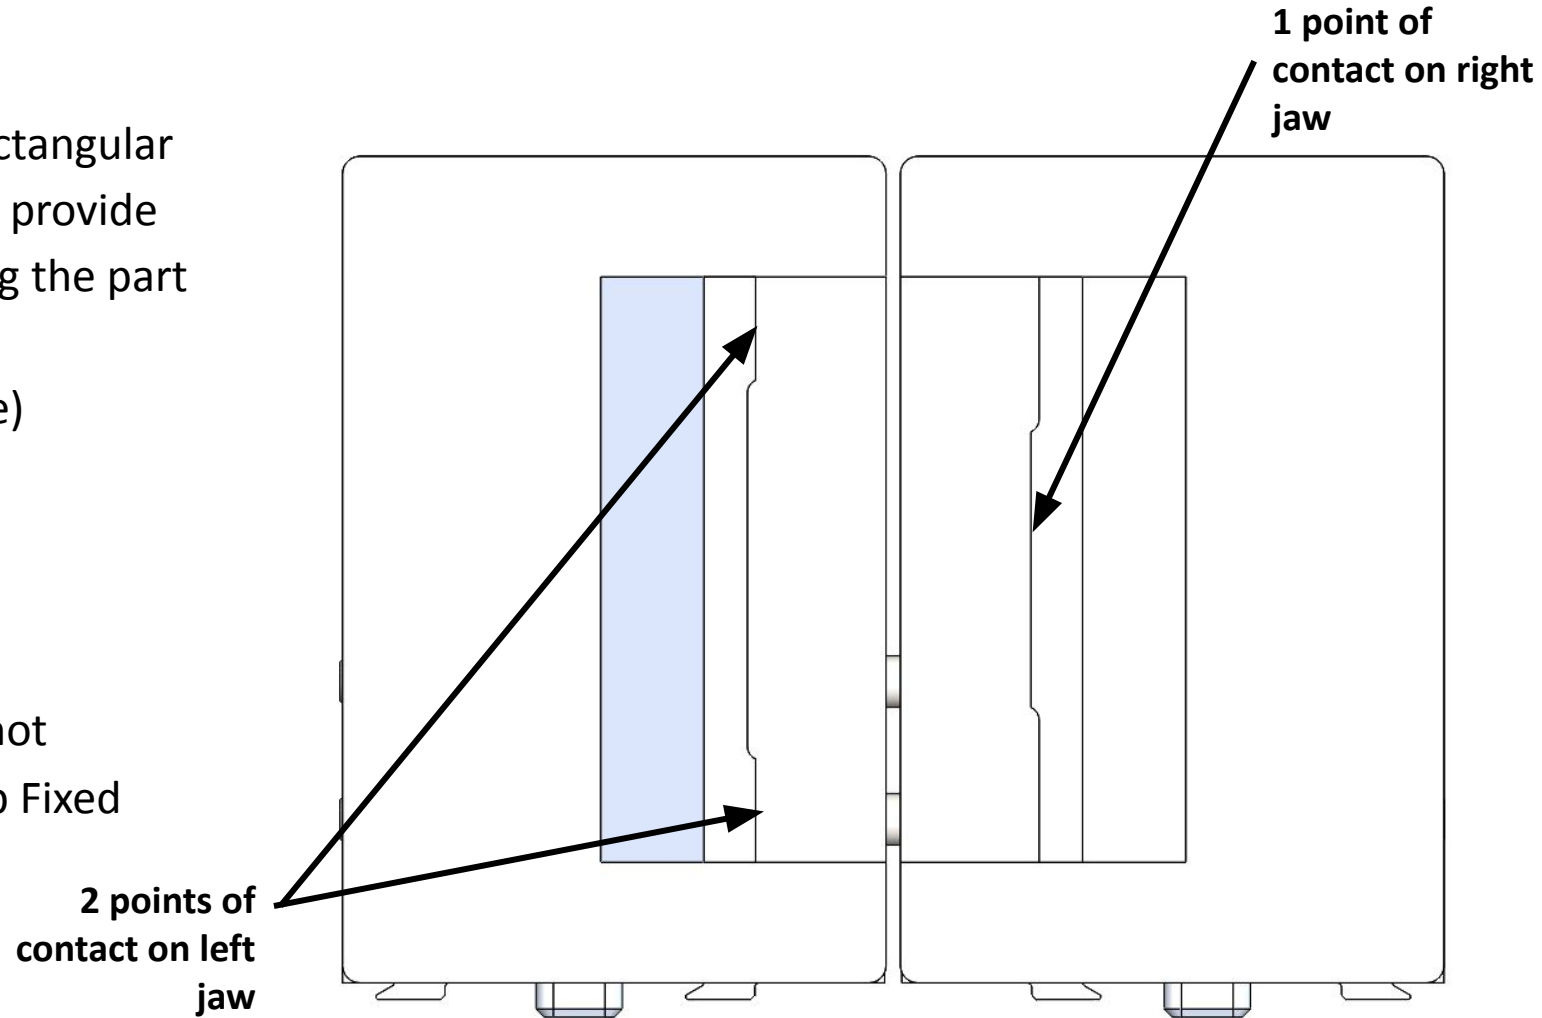

# Jaw Design - Accounting for Jaw Deflection


The clamping force of the MultiGrip Vise is on the bottom side of the MultiGrip Jaws, with the clamping surface against the part on the top side. With this design, there is a small deflection of the jaws proportional to the clamping force and height of the jaws.

- OD Jaws will rise in the middle and deflect out (frown)
- ID Jaws will rise on the outside and deflect in (smile)

To account for this deflection:

- Machine jaw pockets with the spacer in the highest position possible
- Add an undercut to the jaws to force the clamping surface as high as possible
- Include a reinforcement feature to the sidewall, chamfer or fillet
- If available, machine pocket with a 1-degree tapered end-mill

At 120 PSI vise pressure, and depending on clamping depth, deflection ranges from 0.05 to 0.15° with chamfer feature, 0.10 to 0.25° without.


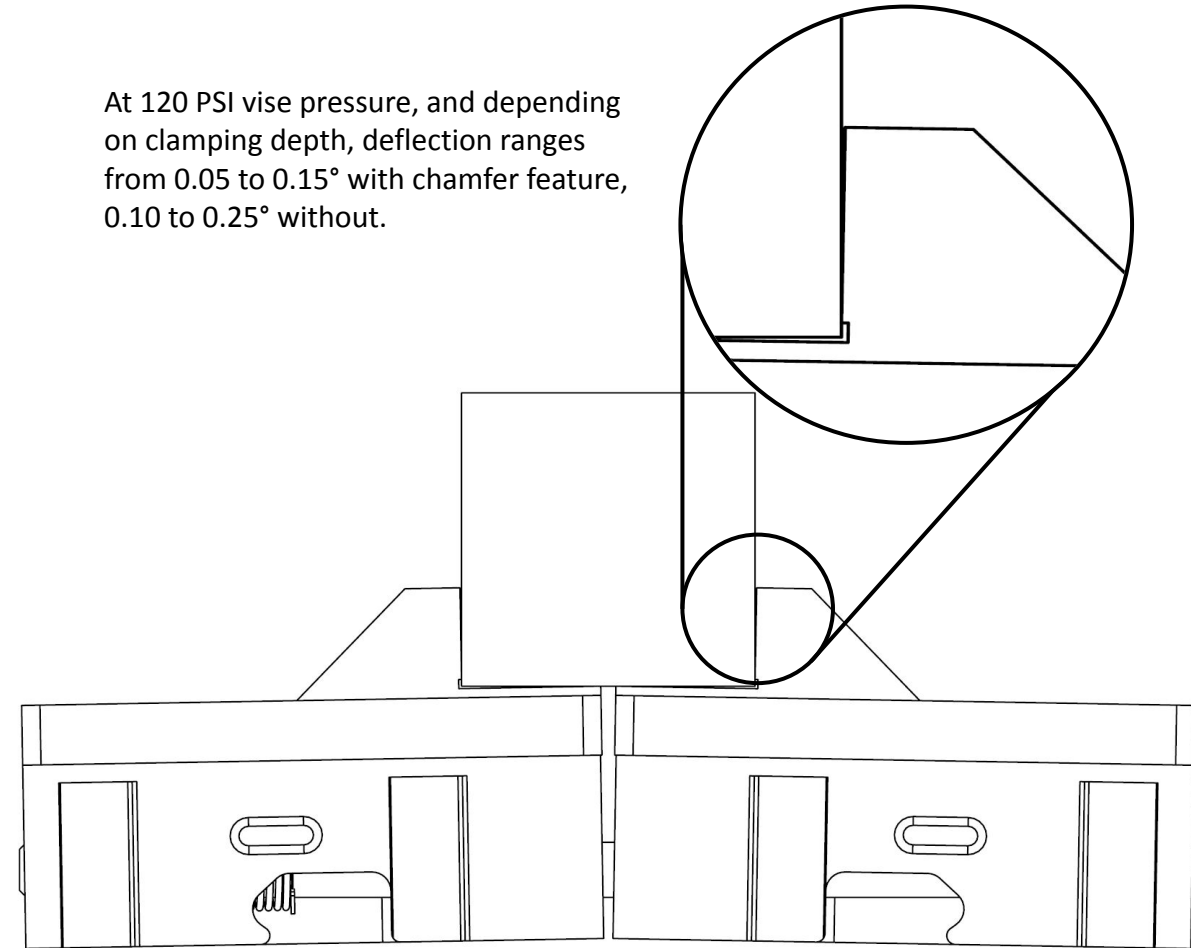


**Exaggerated view of Jaw Deflection with OD Jaws**



# Jaw Design - Large Parts


- Parts may overhang the front or back of the jaws
  - Parts up to 16 inches long can be robot loaded
- Without a Y datum to locate against, the part will need to locate the Y datum using a Y-push
- Oversized Top Plates can be used to better support larger parts

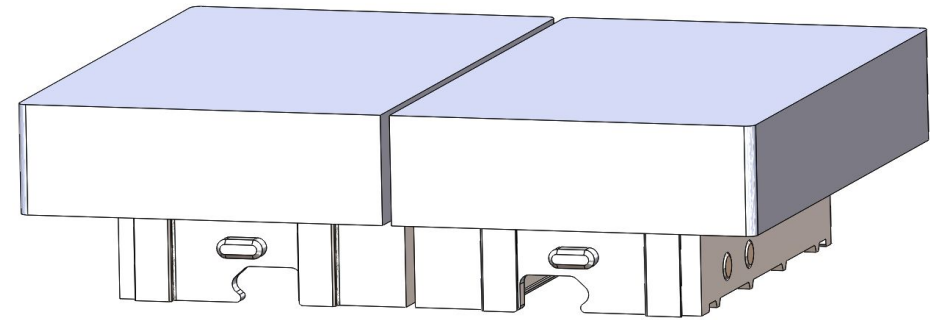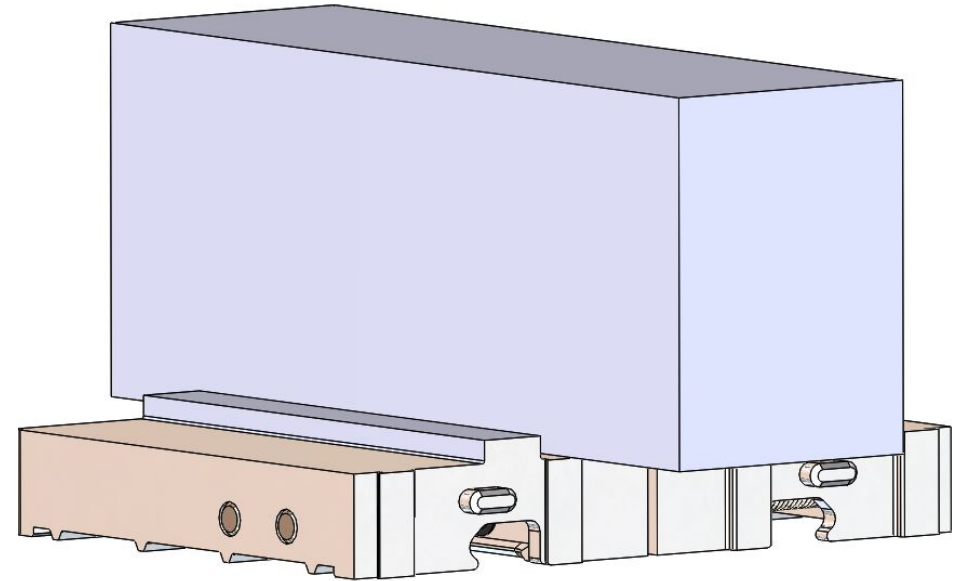



# Jaw Design - Large Parts

- Oversized Top Jaws are two inches wider and two inches longer than standard Top Jaws
- Can be used to better support larger parts during the CNC machining process
- Custom oversized jaws are also available

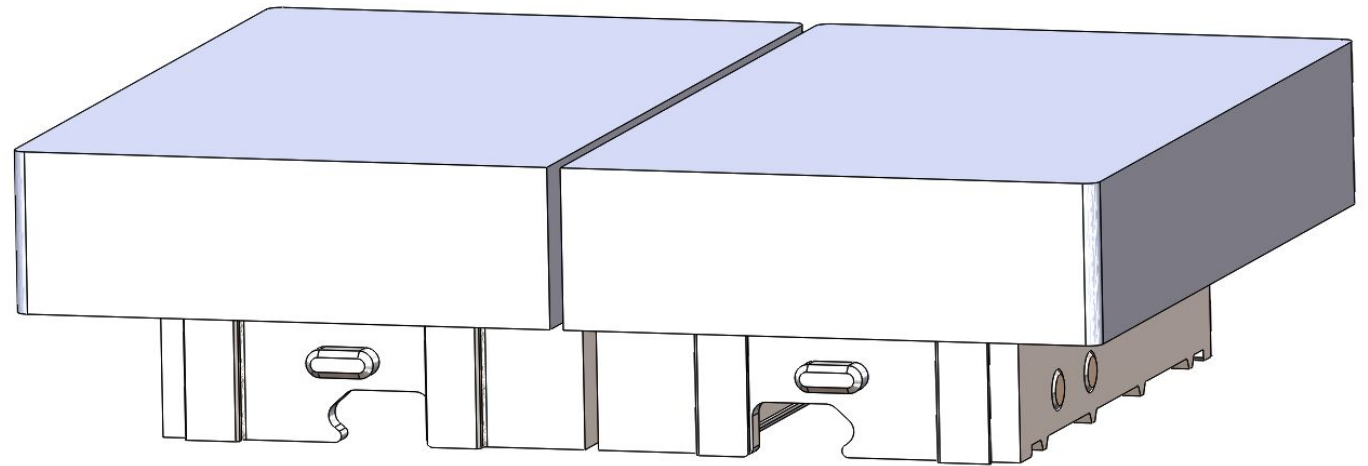

# MultiGrip Jaw Process Recommendations

- MultiGrip Jaws are used as workholding and the part gripper.
- The CNC and the Robot can be used together for precision, repeatability and process control, as well as replicating machinist or operator techniques to process parts (e.g., using a mallet to seat a part vs. a z-push tool in the spindle).
- The following pages review:
  - Part settling (seating parts against Y and Z datums)
  - Using a CNC Probe
  - Jaw durability


# Part Settling

- Part settling is the term used to accurately position a part in the MultiGrip jaw pocket for CNC processing (Y or Z direction)
- Accuracy and repeatability of the workpiece in the workholding can be affected by the part geometry, part weight and the jaw pocket design
- Almost any part can be accurately positioned in MultiGrip Jaws for automated processing using the right combination of tools for the part being settled:
  - Sound jaw pocket design
  - Opening and closing the vise after loading to settle part in Z
  - CNC settling programs and part settling tools, such as a rubber ended tool to push the part down
  - CNC spindle probes
- Push Tools from VersaBuilt
  - Y-Push Tool - Flat end tool in the Spindle to position Y-location of part via CNC motion
  - Z-Push tool - Rubber end tool in the Spindle to push part against Z-datum via CNC motion


*\*Systems with added Vise Exhaust option, allow the vise to hold the clamping position (with zero pressure), then position the part with a Y or Z tool, then re-apply air pressure to clamp the part*

# Part Settling


- To prevent part lift in Z during clamp, avoid a radiused corner between the Z locating surface of the jaws and the jaw pocket wall, examples:
  - Z-Pads on the floor of the jaw pocket
  - Key cutter undercut on the jaw walls
- When possible, use the shape of the part to locate the part in Y and if required, rotation about Z

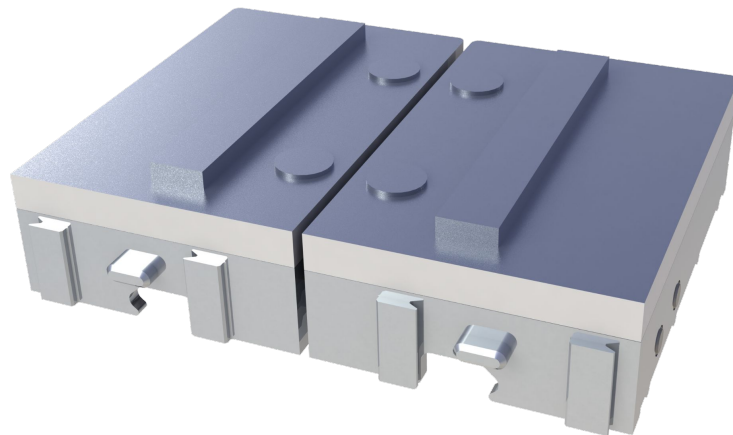

Pads on floor of Jaw Pocket

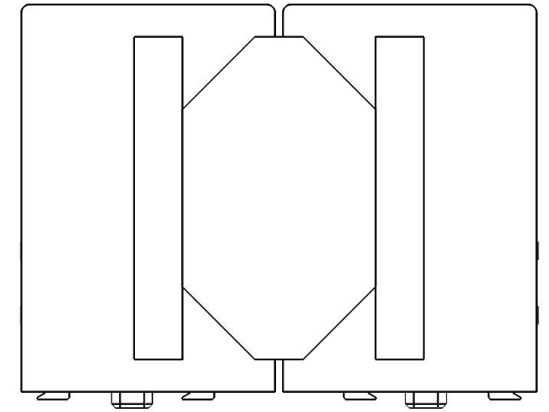

Jaw Pocket does not locate part in Y

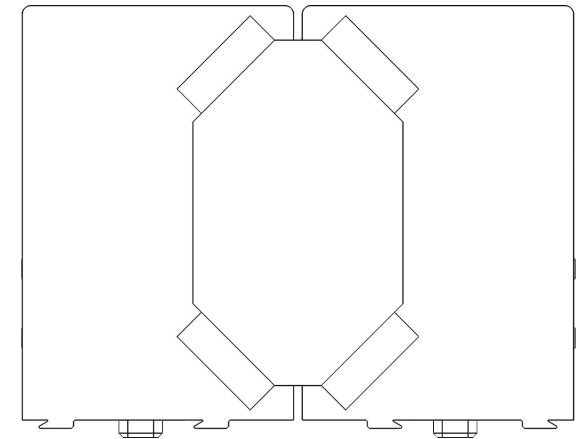


Jaw Pocket locates part in Y and rotation about Z

# Pick Settle and Vise Settle

- After picking a part from infeed or the OP 1 vise, the part will not be settled fully in Z
- By default, the VersaBuilt System Controller (VSC) will open and close the gripper after the pick to make sure the part is held securely
  - Settling the part in the gripper does not ensure the part is full seated in Z after the jaws are loaded into the vise
  - Gripper Open, with OD Jaws, sets the left/right jaw gap to 0.78-inches
- By default, the VSC will open and close the vise after load to ensure the part is settled in Z using the force of gravity
  - Vise Open, with OD Jaws, sets the left/right jaw gap to 0.45-inches

# Part Settle in CNC Program


- If gripper and vise settle options do not provide consistent or sufficiently accurate results, a CNC settle program can be used to more accurately position the part in the jaws
- Best practice is at the start of the milling program to call up a compliant tool (z-push tool) that can push into the part, exhaust pressure from the vise, push the part with the compliant tool, then pressurize the vise, preferably while the tool is still pushing on the part
- See the VSC manual for G-code vise control commands
- For applications using a Generic CNC driver, CNC Part Settle Program is selected as an option in the part configuration
  - When selected, the VSC will call a separate CNC program to perform the settle
  - The G-code program must be modified to include the call to the settle program before the milling program

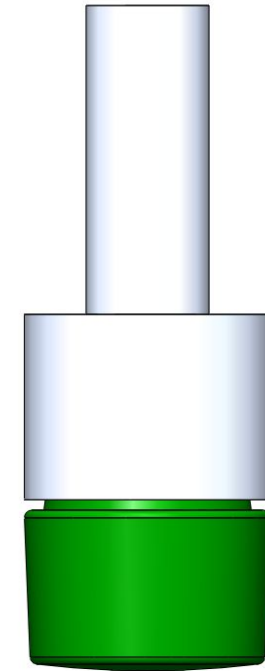

Z-Push Tool  
VersaBuilt P/N 5002394

# OP 1: Locating Rectangular Parts in Y


- Rectangular part shapes can shift along the Y axis when picked from infeed
- Operators typically cannot locate the part accurately enough to ensure the machining operation is successful
- There are two options for locating rectangular parts in Y:
  - Building a Y datum into the MultiGrip Jaws and using the Pick Settle option with a Pick Settle Angle
  - Using the OP 1 Y Push option to allow the robot to push the part to a datum after the vise is loaded
- OP 1 Y Push is generally accurate enough for first operations and works well with the VersaBuilt Universal Top Jaws

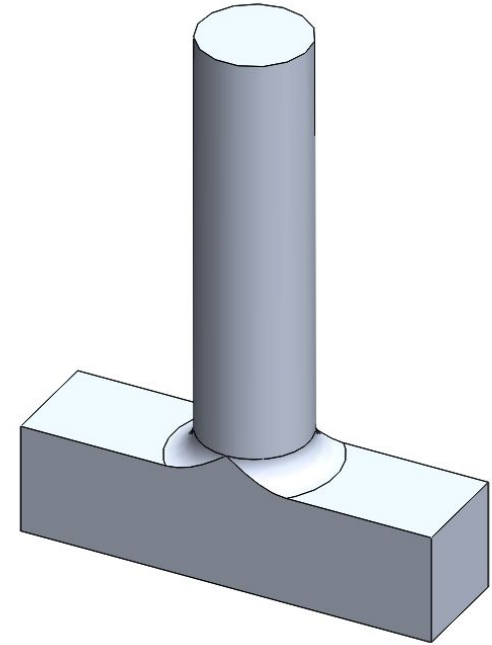

Z-Push Tool  
VersaBuilt P/N 5002394

# OP 1 Pick Settle with Y Datum in MultiGrip Jaws


- To use Gripper Settle to locate a part in Y, the jaws should be designed with a datum in Y, generally near the negative Y edge of the jaws
- The datum should be positioned so the part is centered in the jaws if the part is less than 5.5" in length; for longer parts, the datum should be at the front edge of the jaws and the part will overhang the jaws in the positive Y direction
- In the Part Configuration, under Advanced Configuration, a Pick Settle Angle can be specified
- For a Y datum nearest the gripper interface, use a positive Pick Settle Angle

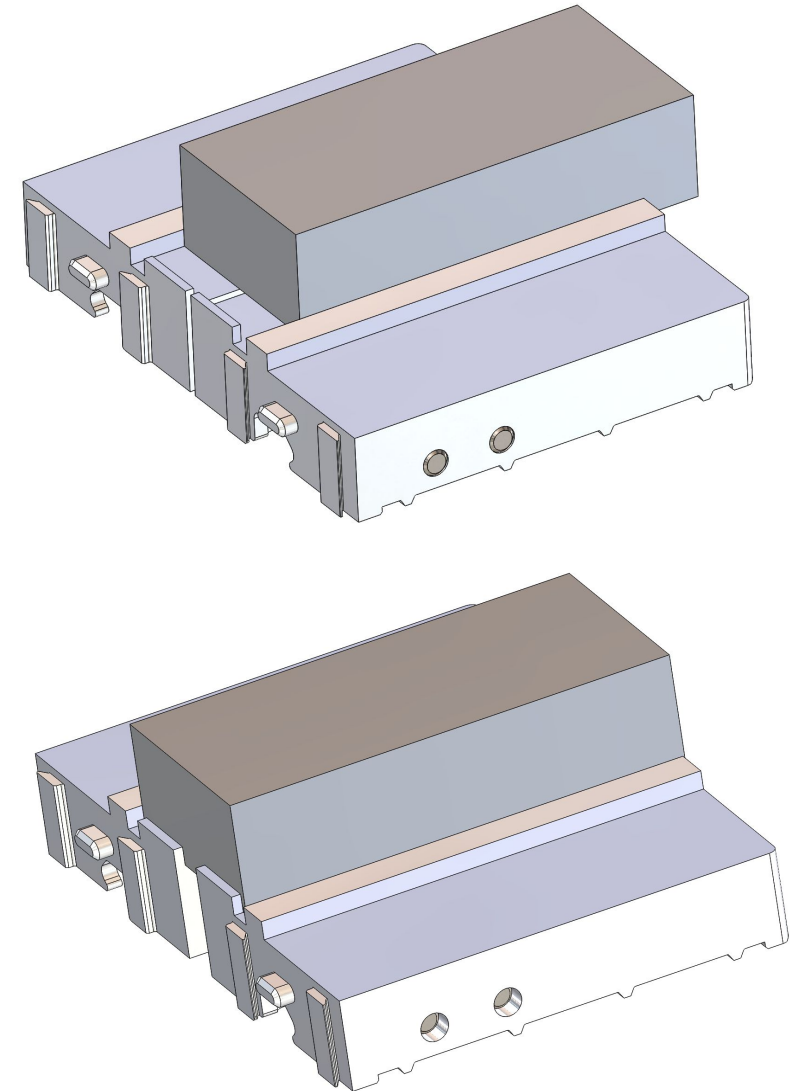




# OP 1 Robot Y-Push

- OP 1 Y Push, using the robot gripper, can be used to push the part into position. Op 1 Y Push option is available when Show Advanced Configuration is selected in the Part Configuration
- By default, the robot will use the gripper to push the part to the center of the vise based upon the part length entered
- Optionally, the height offset the gripper pushes the part can be set
- The **OP 1 Y Push Height Offs** is an offset from the top of the part loaded in the vise the the gripper will push from
  - Default value is -0.150" (3.5mm) or 0.150" below the top of the part; positive values would be above the part
  - Top of the part is calculated from the **Pick Height**
- **OP 1 Y Push works best with parts wider than 2"; always test the OP 1 Y Push before assuming it will work for your application**

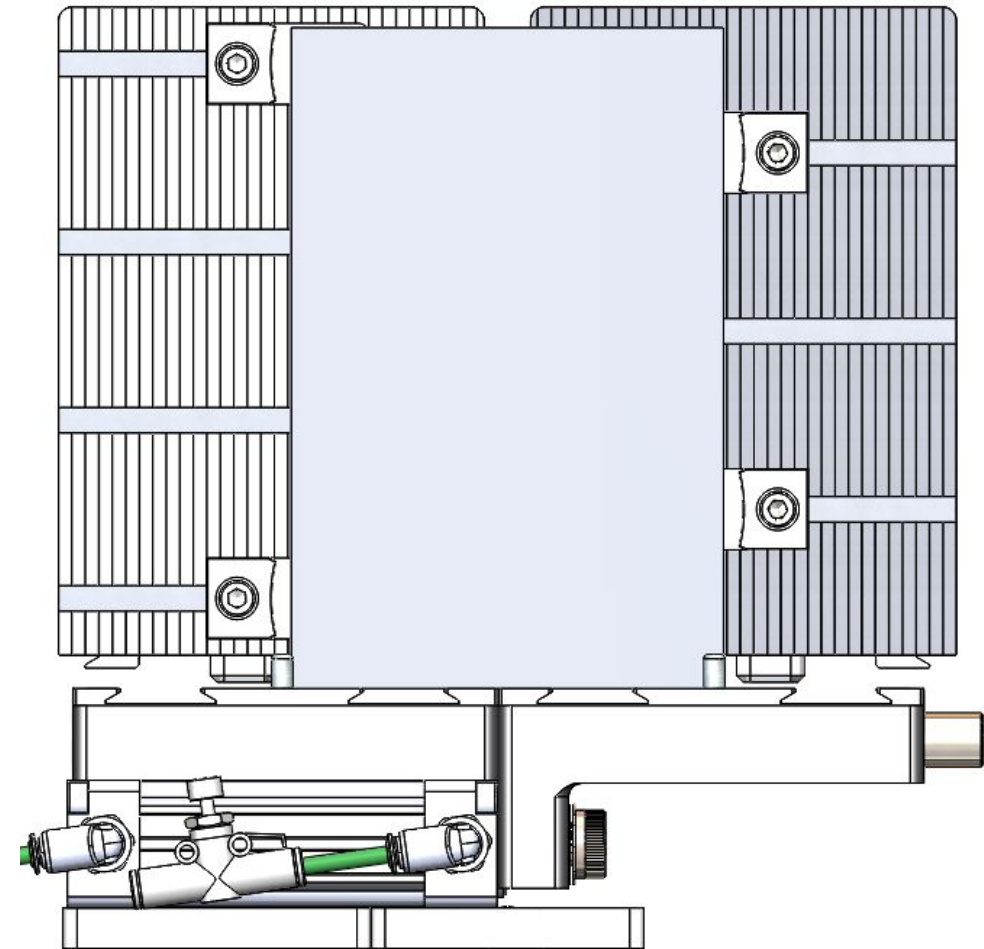

# OP 1 Robot Y-Push

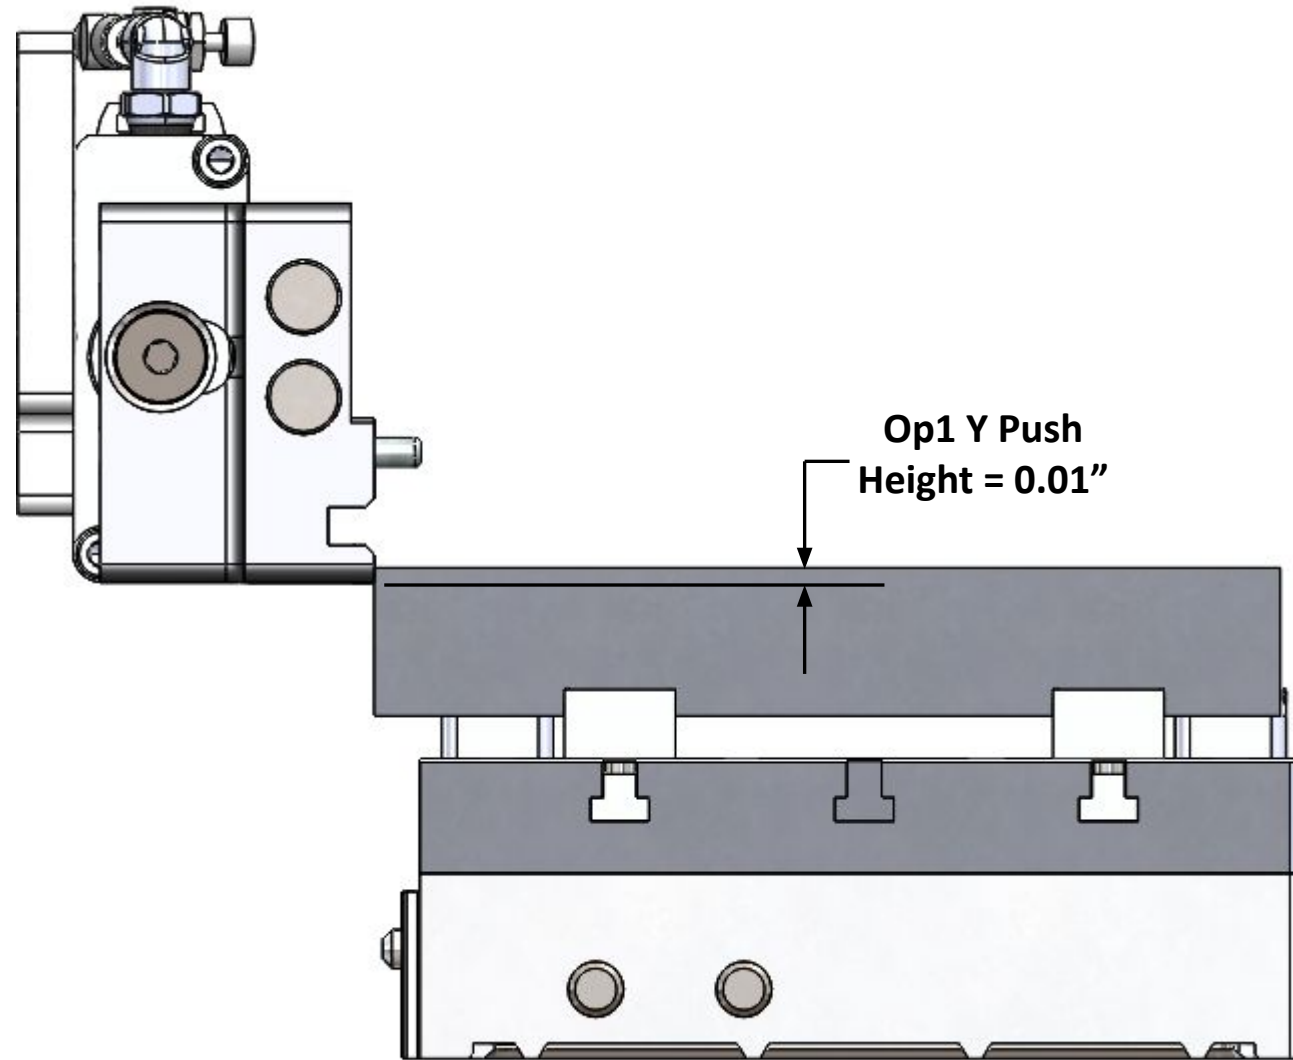

# OP 2: Locating Rectangular Parts in Y

- When the shape of the part and the OP 2 jaws cannot adequately locate the part in Y during clamping, additional measures are needed
- There are two options available for locating rectangular parts in Y:
  - Building a Y datum into the OP 2 MultiGrip Jaws and using the Transfer Settle and Transfer Settle Angle options under the Advanced Configuration Options
  - Using a CNC probe to set the OP 2 CNC home location in Y
    - Requires a valid datum for the CNC probe to reach
    - Typically a through hole feature from OP 1 the probe can reach or a side profile that was machined in OP 1

# Using a CNC Probe

- A CNC spindle probe is a very useful tool for validating the automation process and can be used for the following purposes:
  - Automatically measure parts and perform tool wear offsets to keep parts in tight tolerance
  - Validate the positional accuracy of the part or MultiGrip jaws in the CNC machine before machining
  - Offset home position due to thermal changes or part load position for rectangular parts (generally OP 2 only, see next pages)
- Refer to CNC spindle probe documentation included with your machine for more information
- Remember that spindle probes require regular calibration to maintain high accuracy

# Using a CNC Probe to Offset OP 1 in Y

- In general, do not use a CNC Spindle Probe to offset the home location of a rectangular part in Y for OP 1
  - If the part is offset in Y and the OP 2 MultiGrip jaws locate the part along the Y axis (non-rectangular part), the robot may not be able to pick the offset part after OP 1 is complete because the part is shifted from the robot's center of pick
  - If the OP 2 jaws do not locate the part in Y, the part may be offset in Y using a probe in OP 1
- For raw stock that is cut very closely to nominal length, combining an OP 1 Y Push with a probe **is typically OK** because the true position of the part is only offset a very small amount

# Jaw Durability

- MultiGrip jaw components are made from 6061-T6 aluminum for a good balance between low weight and durability
- When machining harder materials, additional considerations may be required for long jaw life:
  - Will the jaw pocket walls deform from hard part materials under vise clamping pressure?
    - If the clamping surfaces of the part are smooth and total vertical wall clamping surface area of the jaw pocket is greater than 1" squared, bare aluminum will generally suffice
    - Otherwise, we recommend a jaw pocket be made from hardened steel and bolted to the jaws as an insert
  - Will chips from the cutting process strike critical portions of the jaws with enough force to wear the jaws?
    - Hard anodizing the MultiGrip Top Jaws or the use of a hardened steel insert will generally manage wear issues

# Preparing to Automate a New Part

## Section 5

# Preparing to Automate a New Part

## Steps to automate a new part:


1. Prove out machining of the part by hand loading
2. Determine pick, transfer and place heights from CAD or physically measure
3. Weigh jaws and parts
4. Configure Jaws and Part in VSC
5. Setup and Run Job






# Prove out Machining

- Design first op and second op jaws according to the MultiGrip Machinist's Manual
- Validate CNC process is functioning as expected by hand loading parts into jaws
- After first operation is complete, weigh and record half-completed part for next step
- After second operation is complete, weigh and record completed part for next step

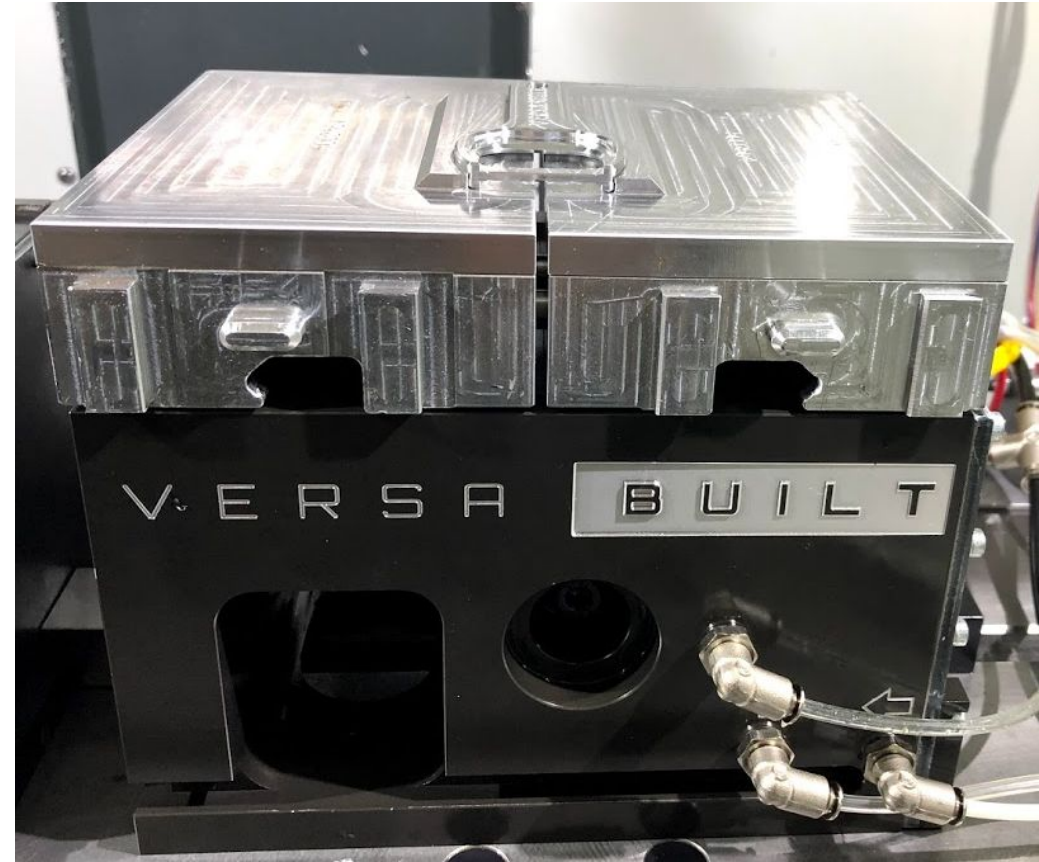


# Determine Pick Height

- Measure Pick Height from CAD
  - \*Optionally, jaws and parts can physically be measured with a height gauge*
- Pick height is measured from the bottom of the MultiGrip Jaw to the top of the raw material
- **Tip:** Enable Part Find on Pick is an option in the part configuration that uses the robots force sensors to find the part height more accurately

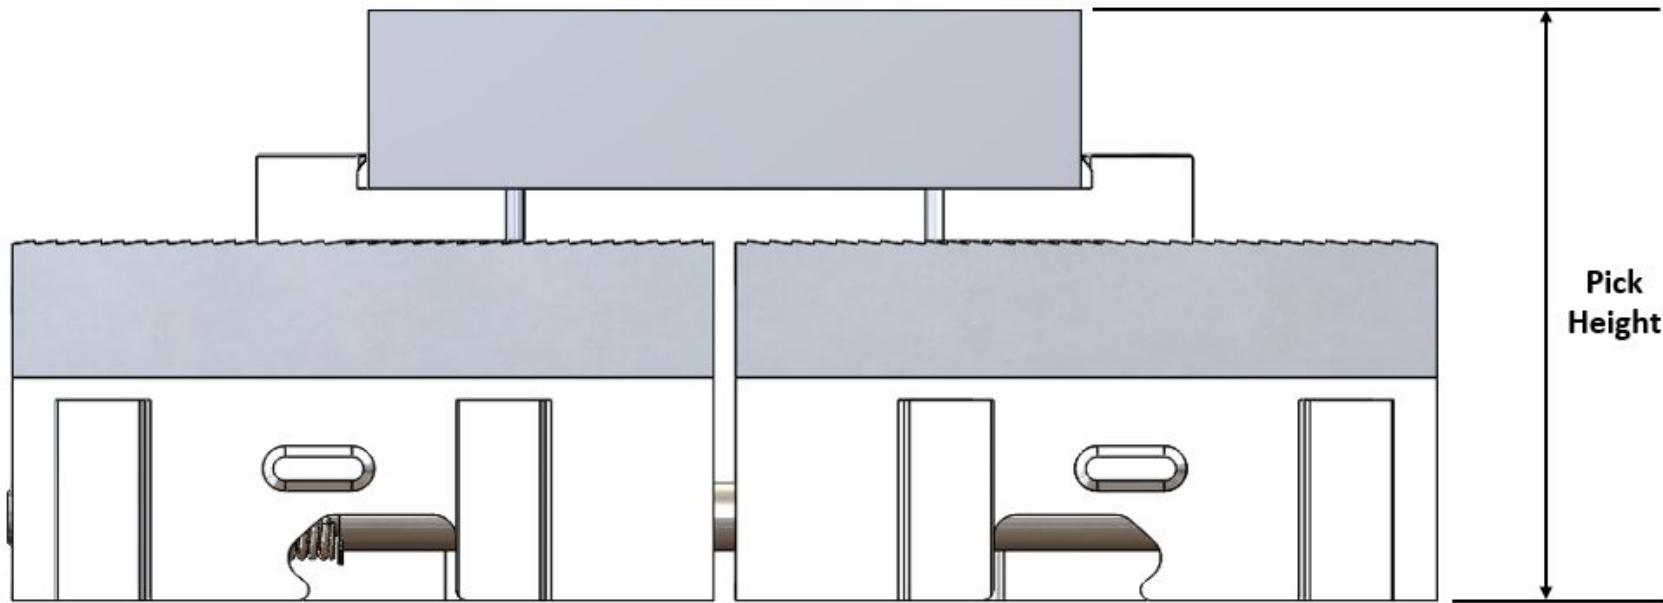


# Determine Transfer Height

- Measure Transfer Height from CAD
  - Optionally, jaws and parts can physically be measured with a height gauge*
- Transfer height is measured from the bottom of the first op jaw to the bottom of the second op jaws with the after first op part (½ complete part) coincident with the Z locating surface of the second op jaws

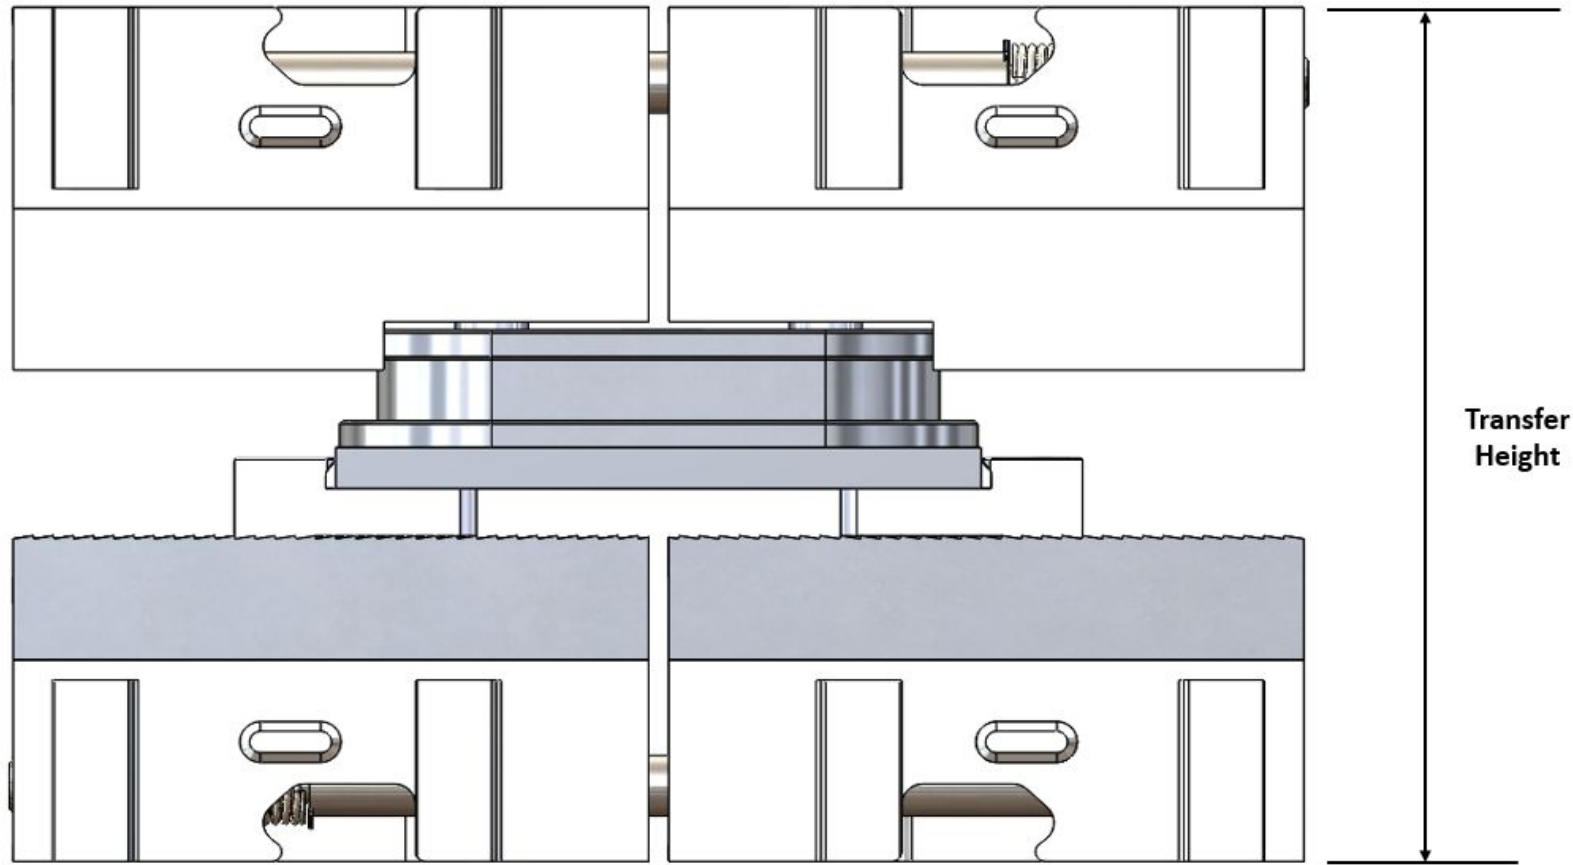

# Determine Place Height

- Measure Place height from CAD
  - Optionally, jaws and parts can physically be measured with a height gauge*
- Place height is measured from the bottom of the second op jaw to the top of the completed part

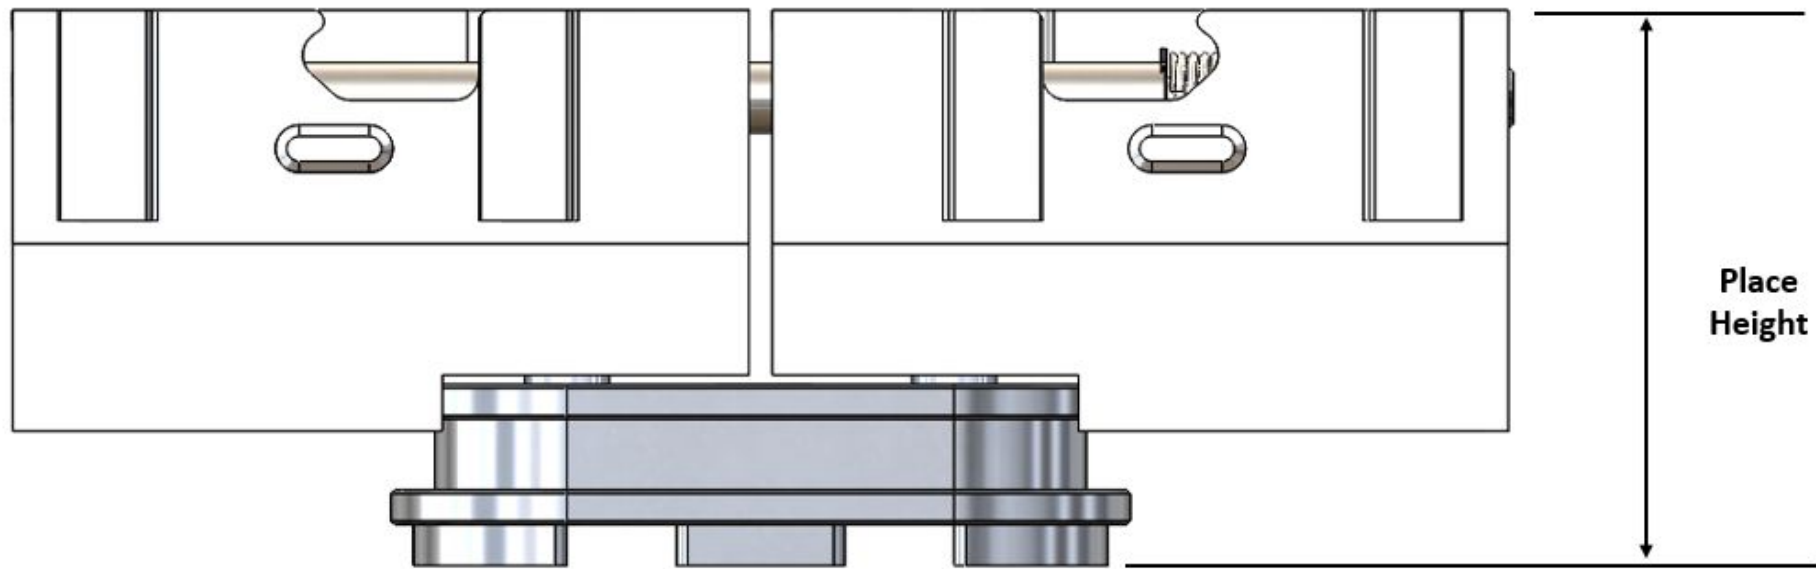

# Preparing to Automate a New Part

## Gather Jaw and Part weight information:


- First Op MultiGrip jaws weight
- Second Op MultiGrip jaws weight
- Weight of raw material before machining
- Weight of part after first operation machining is complete
- Weight of completed part



# Preparing to Automate a New Part

## OP 1/2 Part Y Locating Strategy:

- Generally only required for rectangular parts
- If part will require Y Locating after OP 1 or OP 2 load, determine whether the process will be best served by a Y push or a datum in the jaws and a pick settle angle

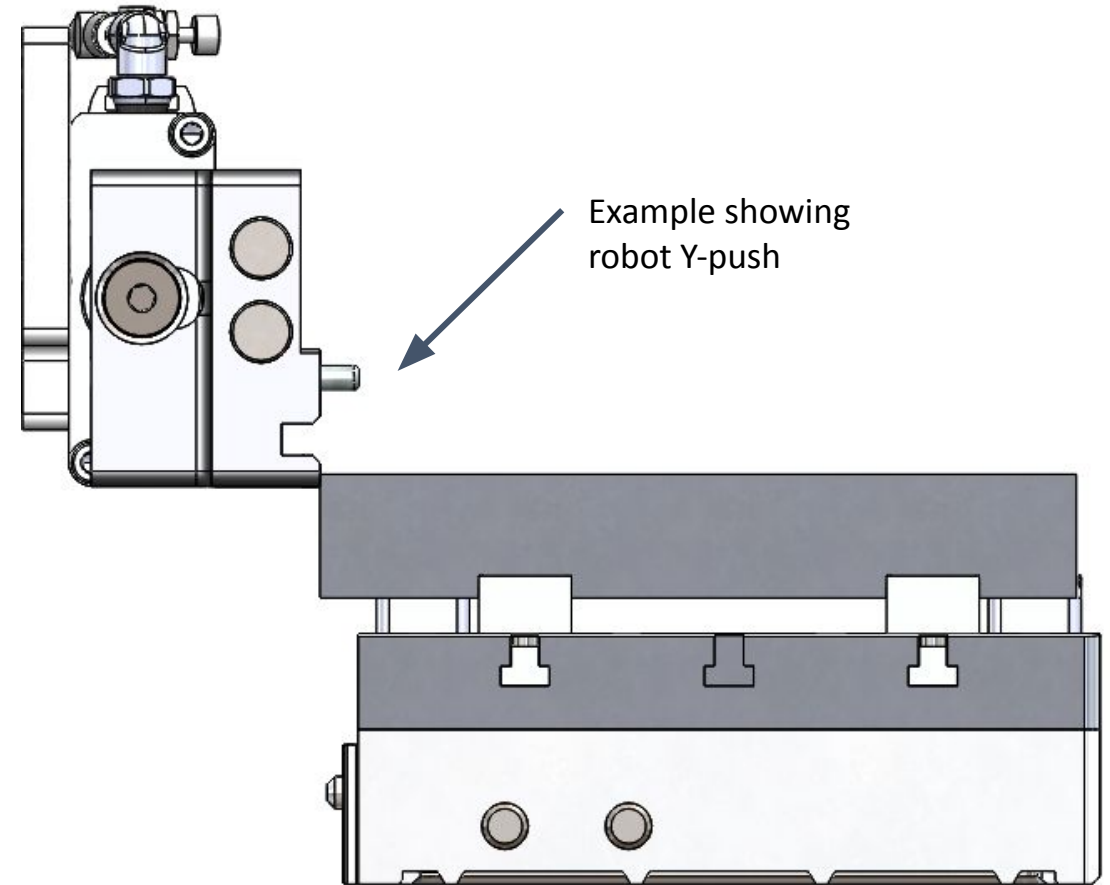

# Creating Jaws and Part Configurations

## Section 6



# Connect to the VSC

## Configure Robot for VSC (robot dependent)

Some robots require a VersaBuilt program to be run on the robot's teach pendant or the robot to be put in a special mode for the VSC to be able to control the robot.

Review the **VersaBuilt Robot Installation, Configuration and Operation** manual that matches your robot make and model for possible additional steps required to enable operation with the VSC.

## Open the VSC Home Page


The VSC is accessed by a phone, tablet or computer.

Using a phone, tablet or computer, open the **VSC web page** using the following address:

**192.168.4.1:9000** for *Wifi* connected devices

**192.168.2.1:9000** for *Ethernet* connected devices



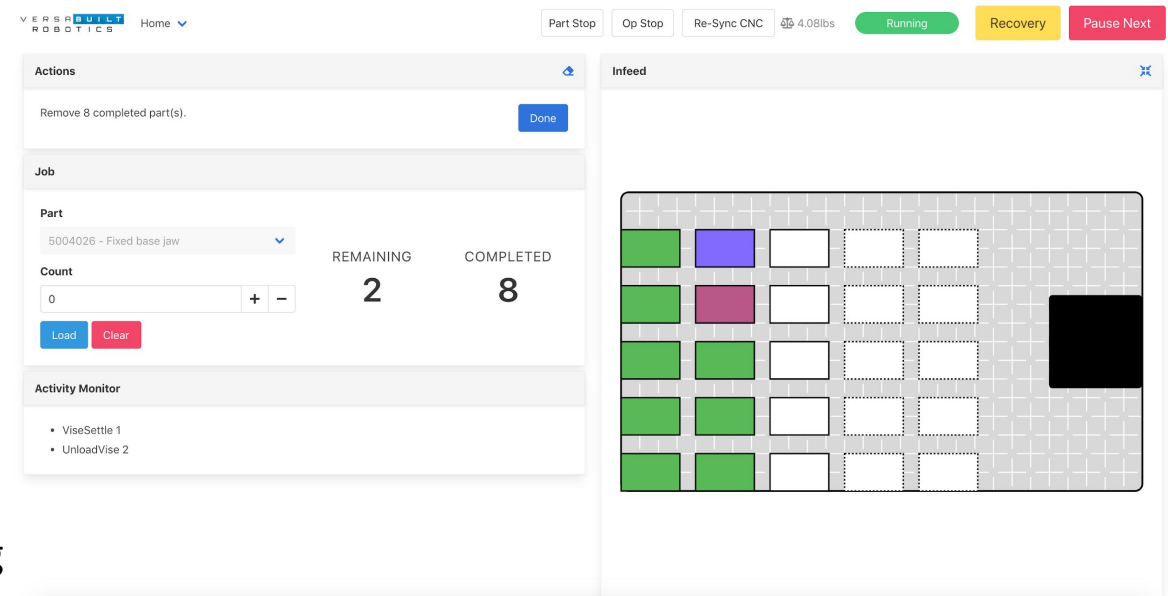


\*For more information on how to configure the device networking to access the VSC, see the VSC Mill Operators Manual.







Wifi connection is vsc + serial number (e.g., vsc00125)  
Wifi password = versabuilt



# VSC Configurations

Jaws +				
Name	Description	Clamp	Weight	Edit
5003737	5003722	OD	6.2	
5007779	Op2_uni_op2jaws	OD	6.8	
Universal OP1 Jaws	OP1 jaws	OD	8.08	
VersaBuilt Rectangle A	VB Test Rectangle	OD	4	
VersaBuilt Rectangle B	VB Test Rectangle	OD	6.2	

Parts +		
Part Number	Description	Actions
One Op Test	One Op Test	 
Generic One Op	Generic CNC driver test.	 

The VSC Configurations page allows MultiGrip Jaws and Part configurations to be stored in the VSC

Jaws are configured separately from Parts because MultiGrip Jaws can be used by more than one part configuration

Once a Part configuration is complete, it can quickly be recalled at any time by the operator from the Home screen

# VSC Jaw Configurations

VERSAR **BUILT** ROBOTICS

Configurations ▾

Part Stop Op Stop Resync CNC

Jaws +				
Name	Description	Clamp	Weight	Edit
5008982 - Op2 Jaws for MultiGrip FJ Piston	Op2 Jaws for 5007867	OD	5	

**Jaws**

Name

Description

Clamp

☒ OD ☐ ID

Weight (Pounds)

Save Cancel Delete

A new Jaw configuration is created by clicking on the + in the upper right corner of the Jaws panel

**Name:** Identifier used to select the jaw in the part configuration

**Description:** Additional text to display to the user

**Clamp:** Identify if the jaws use OD (Outer Diameter) or ID (Inner Diameter) clamping

**Weight:** Weight of the jaws

# VSC Part Configurations

Parts <span>+</span>		
Part Number	Description	Actions
5005547 - 1.5" Top Jaw - Fixed Side	MultiGrip Top Jaw Fixed Side - 1.5" x 4" x 6.15" blank	 
5007867 - MultiGrip FJ Piston	MultiGrip FJ Piston -	 

A new Part configuration is created by clicking on the **+** in the upper right corner of the Jaws panel

Parts	
Part Number	
<input type="text"/>	
Part Description	
<input type="text"/>	
Process	
<div><div></div><div>▼</div></div>	
<div>Save</div>	<div>Cancel</div>

**Part Number:** an identifier used by the operator to select the part to run in the Jobs Panel

**Part Description:** a description of the part

**Process:** the script used to process the part; included process script parameters are described on the following pages

# VSC Process Scripts

## VSC Process Script Overview

VSC Process Scripts drive how the Mill Automation System moves parts through the automation process. VSC Process scripts include parameters entered in the part configuration and how the VSC uses those parameters to coordinate robot motion, IO and CNC processing.

The Mill Automation System comes with Process Scripts for one operation parts and Two operation parts. If you're automation application has special requirements, contact VersaBuilt for a quote on a custom Process Script.

### One Op and One Op Generic Process Scripts

These Process Scripts are used for one milling operation parts; that is parts that will have a single milling operation performed per part. The One Op Generic Process script is used with the Generic CNC driver.

## Two Op and Two Op Generic Process Scripts

These Process Scripts are used for two milling operation parts; that is parts that will have a milling operation performed on one side of the part and another milling operation performed on the opposite side of the part. The Two Op Generic Process script is used with the Generic CNC driver.

### Show Advanced Options

By default, Process Scripts show the basic information required to implement the process, advanced options are set to default values. To show advanced options, click on the Show Advanced Options button.

# One Op Process - Standard Options

Parts

Part Number

Part Description

Process

One Op

☐ Show Advanced Options

Pick Height (Inches)

Place Height (Inches)

Part Width (Inches)

Part Length (Inches)

Raw Part Height (Inches)

0

Jaws

Op 1 CNC Program

Clamping Pressure (psi)

120

Raw Material Weight (Pounds)

Post Op Part Weight (Pounds)

Save

Cancel

**Pick Height:** pick height measured from the bottom of the MultiGrip Jaws to the top of the part (raw material)

**Place Height:** place height measured from the bottom of the MultiGrip Jaws to the top of the part (finished part)

**Part Width:** width of the part before processing

**Part Length:** length of the part before processing

**Raw Part Height:** height of the part in the infeed before processing

**Jaws:** MultiGrip Jaws to be used in the process

# One Op Process - Standard Options

**Op 1 Milling Program Number:** CNC program number used to mill the part (**not in Generic version**)

**Clamping Pressure:** set the air pressure of the vise (requires VSC Programmable Pressure option)

**Raw Material Weight** weight of the part before milling

**Post-Op Part Weight:** weight of the part after milling

# One Op Process - Advanced Options

**Enable Part Find on Pick:** when enabled, robot stops 10mm above part and moves down slowly looking for a change in force to detect jaws in contact with part. Defaults to enabled.

**Bin Drop:** when enabled, when a part is complete, the part is released at the calibrated Bin Drop location instead of at the pick location in the infeed. Defaults to disabled.

**Y Push:** option to have the robot push the part to center in the vise; typically used with a -0.25" Y infeed offset (see Machinists Manual)

**Override Y Push Distance:** instead of letting the VSC, calculate the distance to push the part to center, specify the distance

**Y Push Distance:** used with Override option, the distance from the front of vise to push to

**Y Push X Offset:** before performing the Y push, specify a distance to move left or right of center when pushing the part

**Infeed Y Offset:** option to offset the pick of the part along the Y axis (clamping axis) of the jaws; typically used for a Y push to center operation in the CNC (see Machinists Manual)

**Y Push Height Offset:** offset from the top of the part the gripper will move down to push the part to center

**CNC Table Load Program:** CNC program number used to position the table for loading by the robot. Defaults to 8000

**CNC Vise Wash Program:** CNC program number used wash the vises of chips and position the table for loading by the robot. Defaults to 8001

# One Op Process - Advanced Options

**Vise:** vise number to load the jaws and part for processing by the CNC in Op 1. Defaults to 1.

**Robot Settle:** option to have the robot open and close the jaws to allow the part to settle in Z and/or against a Y datum (see Machinists Manual). Defaults to enabled.

**Robot Settle Angle:** angle in degrees the robot will rotate the MultiGrip Jaws about X to settle the part against a Y datum in the jaws (see Machinists Manual). Defaults to 0.

**Vise Settle:** option to unclamp then clamp the part after loading in the vise to settle the part in Z (see Machinists Manual). Defaults to enabled.

**Empty Jaws Blow Off:** when enabled, after placing a completed part, robot will blow off the jaws before picking the next part. Defaults to enabled.



# Two Op Process - Standard Options

The form is titled 'Parts' and contains the following fields and sections:

- Part Number:** A text input field.
- Part Description:** A text input field.
- Process:** A dropdown menu with 'Two Op' selected.
- ☐ Show Advanced Options
- Pick Height (Inches):** A text input field.
- Place Height (Inches):** A text input field.
- Part Width (Inches):** A text input field.
- Part Length (Inches):** A text input field.
- Raw Part Height (Inches):** A text input field with the value '0'.
- Op 1:** A section header for the first operation.
- Op 1 Jaws:** A dropdown menu.
- Op 1 CNC Program:** A text input field.
- Op 1 Clamping Pressure (psi):** A text input field with the value '120'.
- Raw Material Weight (Pounds):** A text input field.
- Post Op 1 Part Weight (Pounds):** A text input field.
- Op 2:** A section header for the second operation.
- Op 2 Jaws:** A dropdown menu.
- Op 1 to 2 Transfer Height (Inches):** A text input field.
- Op 2 CNC Program:** A text input field.
- Op 2 Clamping Pressure (psi):** A text input field with the value '120'.
- Post Op 2 Part Weight (Pounds):** A text input field.
- Buttons:** 'Save' and 'Cancel' buttons at the bottom left.

**Pick Height:** pick height measured from the bottom of the MultiGrip Jaws to the top of the part (raw material)

**Place Height:** place height measured from the bottom of the MultiGrip Jaws to the top of the part (finished part)

**Part Width:** width of the part before processing

**Part Length:** length of the part before processing

**Raw Part Height:** height of the part in the infeed before processing

**Op 1 Jaws:** MultiGrip Jaws to be used in the Op 1 milling operation process

# Two Op Process - Standard Options

**Op 1 CNC Program:** CNC program number used to mill the part in Op 1 (**not in Generic version**)

**Op 1 Clamping Pressure:** set the air pressure of the vise during Op 1 milling (requires VSC Programmable Pressure option)

**Raw Material Weight** weight of the part before milling

**Post-Op 1 Part Weight:** weight of the part after Op 1 milling is complete

**Op 2 Jaws:** MultiGrip Jaws to be used in the Op 2 milling operation process

**Op 1 to 2 Transfer Height:** total stack height, from bottom of Op 1 jaws to bottom of inverted Op 2 jaws for the Op 1 to Op 2 pick (see Machinists Manual)

**Op 2 CNC Program:** CNC program number used to mill the part in Op 2 (**not in Generic version**)

**Op 2 Clamping Pressure:** set the air pressure of the vise (requires VSC Programmable Pressure option)

**Post-Op 2 Part Weight:** weight of the part after Op 2 milling is complete

# Two Op Process - Advanced Options

**Enable Part Find on Pick:** if enabled, robot stops 10mm above part and moves down slowly looking for a change in force to detect jaws in contact with part before clamping. Defaults to enabled.

**Bin Drop:** if enabled, when a part is complete, the part is released at the calibrated Bin Drop location instead of at the pick location in the infeed. Defaults to disabled.

**Y Push:** option to have the robot push the part to center in the vise; typically used with a -0.25" Y infeed offset (see Machinists Manual)

**Override Y Push Distance:** instead of letting the VSC, calculate the distance to push the part to center, specify the distance

**Y Push Distance:** used with Override option, the distance from the front of vise to push to

**Y Push X Offset:** before performing the Y push, specify a distance to move left or right of center when pushing the part

**Infeed Y Offset:** option to offset the pick of the part along the Y axis (clamping axis) of the jaws; typically used for a Y push to center operation in the CNC (see Machinists Manual)

**Y Push Height Offset:** offset from the top of the part the gripper will move down to push the part to center

**CNC Table Load Program:** CNC program number used to position the table for loading by the robot. Defaults to 8000

**CNC Vise Wash Program:** CNC program number used wash the vises of chips and position the table for loading by the robot. Defaults to 8001

# Two Op Process - Advanced Options

**First Vise:** vise number to load the jaws and part for processing by the CNC in Op 1. Defaults to 1

**Robot Settle and Op 2 Robot Settle:** option to have the robot open and close the jaws to allow the part to settle in Z and/or against a Y datum (see Machinists Manual). Defaults to enabled

**Robot Settle Angle and Op 2 Robot Settle Angle:** angle in degrees the robot will rotate the MultiGrip Jaws about X to settle the part against a Y datum in the jaws (see Machinists Manual). Defaults to 0

**Vise Settle and Op 2 Vise Settle:** option to unclamp then clamp the part after loading in the vise to settle the part in Z (see Machinists Manual). Defaults to enabled

**Op 1 Empty Jaws Blow Off and Op 2 Empty Jaws Blow Off:** when enabled, the robot will blow off the jaws when the jaws empty during processing

**X Vise Transfer Offset and Y Vise Transfer Offset:** an optional offset distance, from center, to be used during the Op 1 to Op 2 transfer

# Fundamentals of Successful Automation

## Section 7

# CNC Process vs Automation Process

The CNC process and the automation process rely on each other for success. The CNC process requires the automation process to:

- Control the automation steps and command robot movements, gripper, vises, CNC doors and execution of CNC programs
- Load the jaws and parts into the CNC vises
- Precisely locate each part in the jaws (CNC process may also control part location)

The automation process requires the CNC process to:

- Wash the vises, jaws and parts of all chips
- Keep the CNC door mechanism free of chips or other debris that could prevent the door from opening or closing
- Remove chips as required to prevent the CNC process from stopping



# Automation Process Errors vs CNC Process Errors


## Automation Process Errors and Typical Causes

- Missed robot pick or missed robot place of a part
  - Part not properly located in the infeed
  - Part dimensional variability (eg part shorter than expected)
  - Poor robot calibration or accuracy
  - Change in air pressure to gripper or vise
- Failure to load or unload a vise
  - Inadequate CNC vise wash program or VersaBlast
  - Poor calibration
  - Robot cart or CNC moved since robot was calibrated
  - Robot that is cold and doesn't accurately move to the expected position
- Failure to properly locate a part or jaws in vise
  - Inadequate CNC vise wash program or VersaBlast
  - Damaged jaws
  - Poor jaw design
  - Variability in part dimensions or other variables
- Robot stop
  - Unexpected collision
  - Actual robot payload significantly different than programmed payload

## CNC Process Errors and Typical Causes

- CNC door fails to open or close
  - Chips not adequately washed away from critical door components
  - Inadequate maintenance
- Unexpected chips or coolant on the floor
  - Inadequate maintenance
  - Lack of understanding in maintenance intervals
- Broken cutting tools
  - Lack of understanding tool life
  - Inadequate coolant system maintenance
  - Tool holder problems
  - Poor jaw design
  - Change in air pressure to vise
- Parts that fail to meet dimensional tolerances
  - Tool life management problems
  - Inadequate jaw design
  - Change in air pressure to vise
  - Inadequate CNC vise wash program or VersaBlast

# Validating the Automation Processes

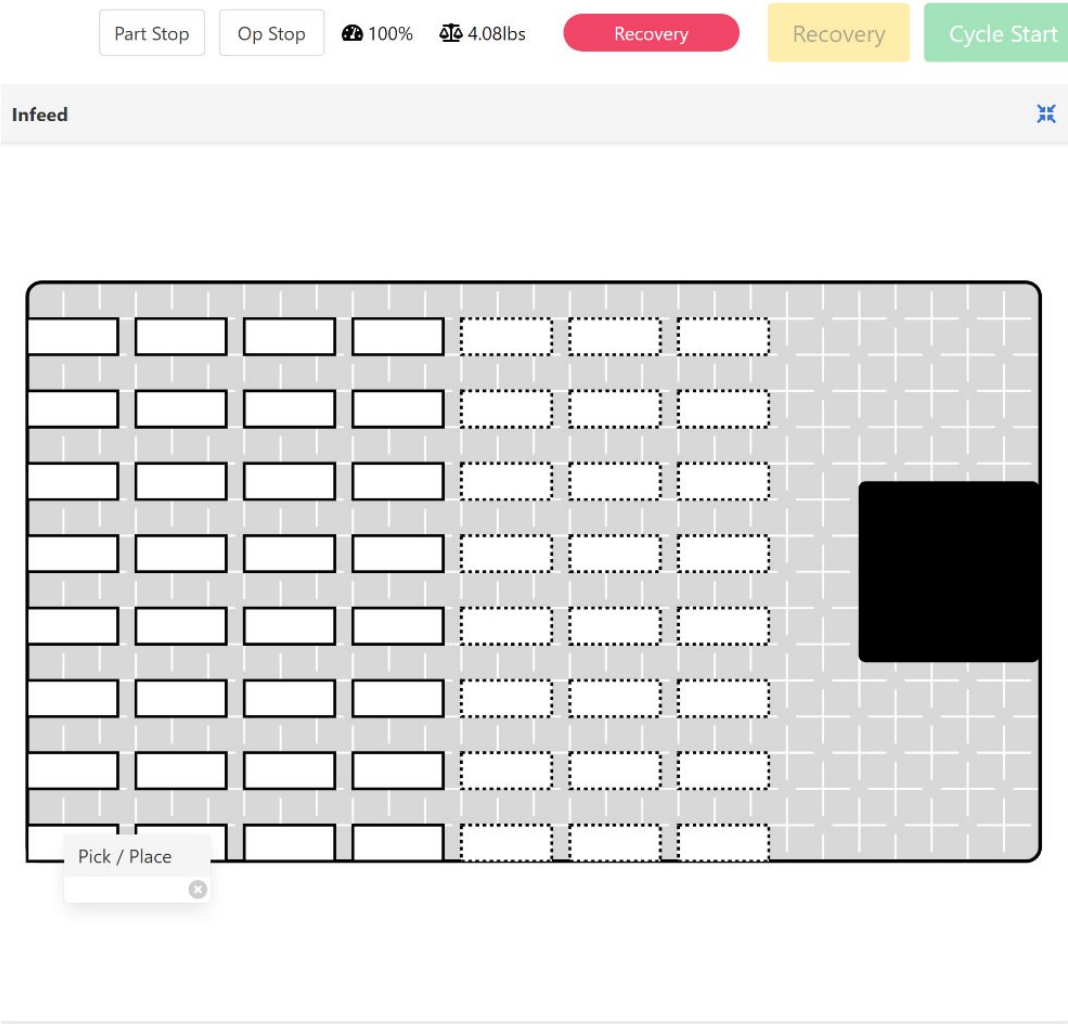

The Mill Automation System basic functions should have been validated as part of the installation process. This includes validating all IO and the calibration of the system. Additional validation tools are available that allow the automation process to be validated on a per part basis. VersaBuilt recommends using these tools as the first parts are automated to gain confidence in the automation process.



# Validating the Automation Processes

Pick Part

Clamp

☒ OD ☐ ID

Pick / Place Height (Inches)

1

Jaw Weight (Pounds)

0

Part Weight (Pounds)

2.9

☐ Find Part

Pick

Place

Cancel

Before testing pick or place, make sure the the VSC is in recovery mode and the desired part configuration selected. To pick, make sure the robot is holding the first operation jaws for the part configuration and a piece of raw material is in the slot on the table you wish to pick from. To place, make sure the robot is holding the final operation jaws and a completed part.

Click on the slot you wish to pick or place from and select Pick/Place from the menu. A dialog will pop-up, fill in the required information, then press the Pick or the Place button.

# Validate the Automation Processes

Vise 1 Load

Part Weight (Pounds)

1.2

Jaws

VersaBuilt Rectangle A

☐ Custom Jaw Weight

Load Type

☒ Jaws ☐ Part

Vise Clamp

☒ OD ☐ ID

☐ Run Wash / Table Load Program

Load

Cancel

Vise 1 Unload

Part Weight (Pounds)

1.2

Jaws

VersaBuilt Rectangle A

☐ Custom Jaw Weight

Unload Type

☐ Jaws ☒ Part

Vise Clamp

☒ OD ☐ ID

Part Clamp

☒ OD ☐ ID

Height (Z) (Inches)

5

X-offset (Inches)

0

Y-offset (Inches)

0

☐ Dump Coolant

☐ Run Wash / Table Load Program

Unload

Cancel

## Load Vise, Unload Vise and Unload Part

Vise functions can be validated from the Recovery panel. Load Vise and Unload Vise are part of system validation and generally only need to be validated as part of the installation process.

Vise Unload Part is part of the Automation Process validation for each part. Place the Op 1 jaws in the vise with a part that has completed the first milling operation. Place the Op 2 jaws in the robot gripper. Press the Unload button in the Recovery panel under the vise holding the Op 1 jaws. Under the Unload Type, select Part. Enter all information including part weight, Jaws (in the robot gripper), vise and part clamp type and height of the Unload Part pick. The height of the Unload Part pick is measured from the bottom of the jaws on the vise to bottom of the jaws in the robot gripper in the inverted state over the part. Verify the robot picks the part with good margins on the gripping.

# Validate the Automation Processes

Vise 1 Load

Part Weight (Pounds)

1.2

Jaws

VersaBuilt Rectangle A

☐ Custom Jaw Weight

Load Type

☒ Jaws ☐ Part

Vise Clamp

☒ OD ☐ ID

☐ Run Wash / Table Load Program

Load

Cancel

Vise 1 Unload

Part Weight (Pounds)

1.2

Jaws

VersaBuilt Rectangle A

☐ Custom Jaw Weight

Unload Type

☐ Jaws ☒ Part

Vise Clamp

☒ OD ☐ ID

Part Clamp

☒ OD ☐ ID

Height (Z) (Inches)

X-offset (Inches)

Y-offset (Inches)

5

0

0

☐ Dump Coolant

☐ Run Wash / Table Load Program

Unload


Cancel

## Load Vise, Unload Vise and Unload Part

Vise functions can be validated from the Recovery panel. Load Vise and Unload Vise are part of system validation and generally only need to be validated as part of the installation process.

Vise Unload Part is part of the Automation Process validation for each part. Place the Op 1 jaws in the vise with a part that has completed the first milling operation. Place the Op 2 jaws in the robot gripper. Press the Unload button in the Recovery panel under the vise holding the Op 1 jaws. Under the Unload Type, select Part. Enter all information including part weight, Jaws (in the robot gripper), vise and part clamp type and height of the Unload Part pick. The height of the Unload Part pick is measured from the bottom of the jaws on the vise to bottom of the jaws in the robot gripper in the inverted state over the part. Verify the robot picks the part with good margins on the gripping.

# Validate the CNC Processes

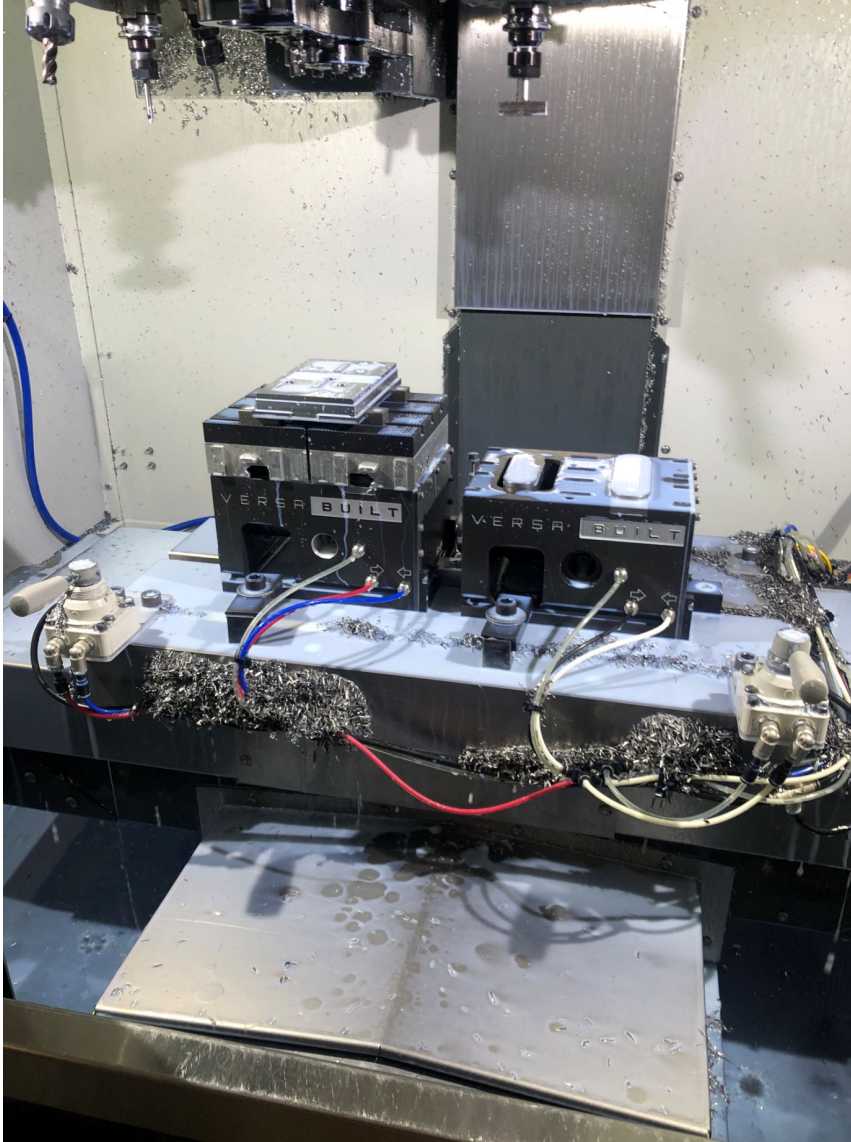

There are three components of the CNC Process that need to be validated and measured:

- Validate that the CNC Process (vise wash program) leaves the part, vises and the gripper interface of the jaws free of chips
- Measure how long the CNC Process can operate before operator maintenance is needed to prevent an unexpected event (eg overflowing chip bin, stuck CNC door, etc)
- Measure how long the machining process can operate before operator intervention is required to ensure parts meet required dimensions

Understanding how long the automation process can run without operator intervention is critical in preventing undesirable results from your automation system.

# Validate the CNC Processes - Vise Wash Program

The importance of the vise wash program is easy to overlook. The most important job of the vise wash program is to make sure that chips created in the machining process do not cause a problem in the automation process. A sample vise wash program is included with the Mill Automation System but it must be verified and customized for each application. The vise wash program must be continuously evaluated as new parts are added to the system. Different parts generate different types of chips and put those chips in different places.

After the vise wash program runs, there should be no chips on the top of the empty vise, no chips on the top of the part (after Op 1 in a two op process) and no chips on the gripper interface of the MultiGrip jaws.

The vise wash program should select a tool that will not collide with parts and jaws as the table is moved. Generally, flood coolant is sufficient to wash away all chips. If through spindle coolant is available, a tool should be selected that provides maximum flow of coolant rather than a small high-pressure stream. Sometimes no tool in the spindle works best.

# Validate the CNC Processes - Operator Maintenance Intervals

All CNCs require operator maintenance to prevent “unexpected events”. If operators perform CNC maintenance primarily by reacting to what they observe, “unexpected events” are much more likely to occur when automation is implemented. When automation is implemented, operators spend less time interacting with the CNC process making them less likely to observe a problem. If lights-out manufacturing is implemented, scheduled maintenance becomes even more critical.

Operator maintenance includes tasks like:

- Adding coolant and check coolant concentrations
- Emptying chip bins
- Cleaning coolant sump and filters
- Cleaning coolant lines of chips
- Washing down chips in the CNC cabinet and CNC door mechanisms
- Way and spindle lubrication

VersaBuilt recommends instituting maintenance intervals with a sign-off sheet. Make sure the automation does not run past any maintenance interval to avoid “unexpected events”.



# Validate the CNC Processes - Machining Process

Like CNC maintenance, the machining process has limits to how long it can continue without operator intervention. Tool life management is the primary factor influencing how long the machining process can operate without intervention. An entire book could be devoted to tool life management.

Tool life management generally falls into one of two categories: operator observation or process-driven proactive management. Process-driven proactive tool management takes time to develop and increases in difficulty in high-mix manufacturing environments. If proactive tool life management is used in conjunction with a CNC's built-in tool expiration (the CNC alarms when a tool expires), the CNC will prevent the automation process from continuing when tool life expires.

If tool life is managed by operator observation, the operator must decide how many parts can run before further operator inspection is required.

# Validate the CNC Processes - Tool and Spindle Probes

Tool and spindle probes can be a very valuable tool for high-mix CNC automation if their limits are understood.

Tool probes can be used to measure the tool length and diameter and can be used for tool breakage detection. Generally, length and diameter work best for measuring new tools but often cannot be relied upon for measuring worn tools. As tools wear, dimensional changes in the part tend to be driven primarily by the cutting edges getting dull and tool deflection rather than the diameter or the length of the tool changing. Using a tool probe for tool breakage detection is slower than other options for tool breakage but generally works well.

A spindle probe is an excellent tool for high-mix CNC automation. A spindle probe can measure critical part features in-process and automatically update tool wear offsets. This can increase the time the machining process is able to run without operator intervention. A spindle probe can also be used as a “dynamic” tool life monitor. You may find that when a tool reaches for example 0.001” of total wear offset from new, the tool is ready to expire.



# Successful Lights-Out Manufacturing

Many companies purchase CNC automation for “lights-out” manufacturing. Before venturing into “lights-out” manufacturing, validate your automation and CNC processes and measure and understand how long your automation can run successfully without an operator present. Hope and automation are two things that don’t go well together.

Although “lights-out” manufacturing may be the goal, understand that CNC automation can provide a great return on investment even if it only works when operators are present to monitor it. CNC automation is primarily a tool that increases the productivity of operators.

In motorcycle racing, you sometimes hear the phrase, “You need to slow down to go faster”. The same can be said for CNC automation. Machinists are typically taught to optimize the speed of the machining process. In high-mix automation, it is more important to optimize the length of time the machining process can run without operator intervention. In addition to making choices about tool and spindle probing, machinists can sometimes make choices in machining and workholding strategies that improve process reliability over process speed. Best to find a balance between speed and reliability with a strong emphasis on reliability.

# Appendices

# One Op Part Configuration Worksheet


Part Number			
Part Description			
Process			
Enable Part Find on Pick	True / False	Bin Drop	True / False
Pick Height		Place Height	
Part Width		Part Length	
Y Push	True / False		
Infeed Y Offset		Y Push Height Offset	
CNC Table Load Program		CNC Vise Wash Program	
Jaws		First Vise	
Robot Settle	True / False	Vise Settle	True / False
Robot Settle Angle		Empty Jaws Blow Off	True / False
Op 1 Milling Program Number		Clamping Pressure	
Raw Material Weight		Post-Op Weight	

# Two Op Part Configuration Worksheet

Part Number			
Part Description			
Process			
Enable Part Find on Pick	True / False	Bin Drop	True / False
Pick Height		Place Height	
Part Width		Part Length	
Y Push	True / False		
Infeed Y Offset		Y Push Height Offset	
CNC Table Load Program		CNC Vise Wash Program	
Op 1			
Op 1 Jaws		First Vise	
Robot Settle	True / False	Vise Settle	True / False
Robot Settle Angle			
Op 1 Milling Program Number		Op 1 Clamping Pressure	
Raw Material Weight		Post Op 1 Weight	
Empty Jaws Blow Off	True / False		
Op 2			
Op 2 Jaws		Transfer Height	
Robot Settle	True / False	Vise Settle	True / False
Robot Settle Angle			
X Vise Transfer Offset		Y Vise Transfer Offset	
Op 2 Milling Program Number		Op 2 Clamping Pressure	
Post Op 2 Weight			
Op 2 Part Blow Off	True / False	Op 2 Empty Jaws Blow Off	True / False

# Bin Drop Option

- Place bucket or bin at location shown
- Protect parts with foam, water or other means

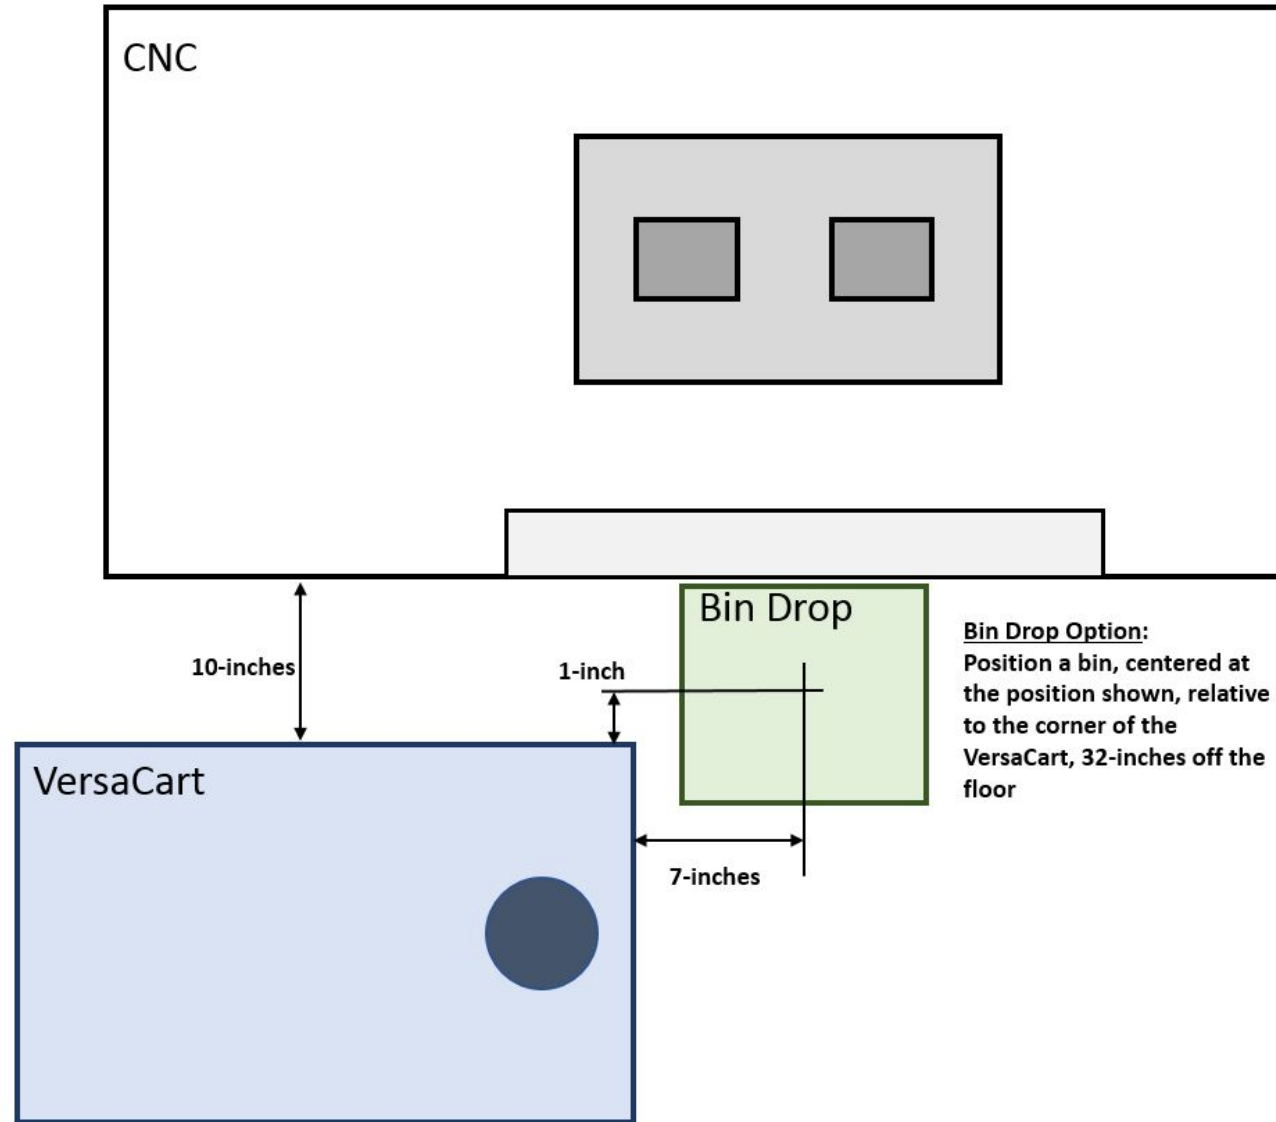

# CNC G-Code Vise Control

- Each of the MultiGrip Vises can be opened or closed from within a CNC program using the included CNC programs
- 9002 program is used for vise control and exhaust
- Call the 9002 program using the G65 command and using D and C parameters:
  - D01. selects vise 1
  - D02. selects vise 2
  - C02. closes the vise
  - C03. opens the vise
  - C06. exhausts pressure from all vises\*
  - C07. pressurizes all vises\*
- Recommend dwelling 1 second to allow vise to actuate:
  - G04 P1.

**\*VSC pneumatics and electrical must include optional exhaust features**

## EXAMPLES:

- Close Vise 1: G65 P9002 D01. C02.
- Open Vise 1: G65 P9002 D01. C03.
- Close Vise 2: G65 P9002 D02. C02.
- Open Vise 2: G65 P9002 D02. C03.
- \*Exhaust Vises: G65 P9002 D01.C06. (Device number doesn't matter, all vises exhaust)
- \*Pressurize Vises: G65 P9002 D01.C07. (Device number doesn't matter, all vises pressurized)

## Z-push with CNC spindle\*

Use exhaust command before spindle push down with z-pushdown tool. After the vise pressure is exhausted, push part down with spindle using the z-pushdown tool. Use pressurized command to pressurize the vises and resume machining operation.

# VERSABUILT ROBOTICS